REPORT DOCUMENTATION PAGE

Form Approved OMB No. 0704-0188

Public reporting burden for this collection of information is estimated to average 1 hour per response, including the time for reviewing instructions, searching existing data sources, gathering and maintaining the data needed, and completing and reviewing the collection of information. Send comments regarding this burden estimate or any other aspect of this collection of information, including suggestions for reducing this burden. To Washington Headquarters Services, Directorate for Information Operations and Reports, 1215 Jefferson Davis Highway, Suite 1204, Arlington, VA 22202-4302, and to the Office of Management and Budget, Paperwork Reduction Project (0704-0188), Washington, DC 20503.

1. AGENCY USE ONLY (Leave blank)

2. REPORT DATE 12/11/85 3. REPORT TYPE AND DATES COVERED

4. TITHE AND SUBTITUE ROCKY MOUNTAIN ARSENAL, COMMERCE CITY, COLORADO

5. FUNDING NUMBERS

6. AUTHOR(S)

DAAA05 85 C 0012

7. PERFORMING ORGANIZATION NAME(S) AND ADDRESS(ES)

HARRISON WESTERN CORPORATION

8. PERFORMING ORGANIZATION REPORT NUMBER


88130R02

9. SPONSORING/MONITORING AGENCY NAME(S) AND ADDRESS(ES)

10. SPONSORING / MONITORING AGENCY REPORT NUMBER

ROCKY MOUNTAIN ARSENAL (CO.) COMMERCE CITY, CO

11. SUPPLEMENTARY NOTES

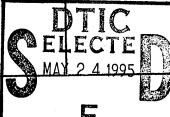

12a. DISTRIBUTION / AVAILABILITY STATEMENT

12b. DISTRIBUTION CODE

APPROVED FOR PUBLIC RELEASE; DISTRIBUTION IS UNLIMITED

13. ABSTRACT (Maximum 200 words)

THIS REPORT DETAILS THE PROCEDURES AND EQUIPMENT USED IN THE CLOSURE OF THE DEEP INJECTION WELL NEAR BASIN F. SECTIONS DISCUSS THE FOLLOWING:

- 1. CONSTRUCTION OF THE SURFACE FACILITIES ASSOCIATED WITH THE WELL; MATERIALS AND METHODS USED IN PLUGGING THE WELL
 - 2. SCHEDULE, LABOR DISTRIBUTION, AND CONTRACTOR PERCENTAGE OF THE WORK
 - 3. DECONTAMINATION PROCEDURES USED FOR PERSONNEL AND EQUIPMENT.

APPENDICES INCLUDE:

- 1. DAILY REPORT SHEETS FROM CHEN AND ASSOCIATES
- 2. CHEMICAL SAMPLING RESULTS FOR WATER, SOIL, AND AIR
- 3. CERTIFICATES OF POST-EMPLOYMENT MEDICAL EXAMINATIONS OF PERSONNEL.

19950522 115

14. SUBJECT TERMS

ABANDONED WELLS, CHEMICAL ANALYSIS, EQUIPMENT, CONSTRUCTION

15. NUMBER OF PAGES

16. PRICE CODE

SECURITY CLASSIFICATION OF REPORT

SECURITY CLASSIFICATION OF THIS PAGE


SECURITY CLASSIFICATION OF ABSTRACT

20. LIMITATION OF ABSTRACT

UNCLASSIFIED NSN 7540-01-280-5500

Standard Form 298 (Rev. 2-89) Prescribed by ANSI Std. 239-18

DISCLAIMER NOTICE

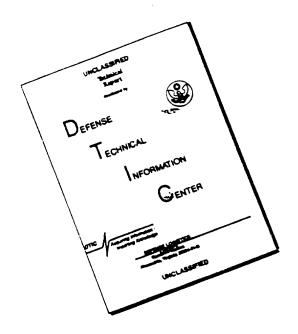

THIS DOCUMENT IS BEST QUALITY AVAILABLE. THE COPY FURNISHED TO DTIC CONTAINED A SIGNIFICANT NUMBER OF PAGES WHICH DO NOT REPRODUCE LEGIBLY.

88130ROZ *
NON-DOT REVIEWED &
ZOOPY

PROJECT COMPLETION REPORT

FOR

DEPARTMENT OF THE ARMY CONTRACTING DIVISION ROCKY MOUNTAIN ARSENAL COMMERCE CITY, COLORADO

PREPARED BY
HARRISON WESTERN CORPORATION
DON J. BUTLER
PROJECT ENGINEER
DECEMBER 11, 1985

CONTRACT NUMBER: DAAA05-85-C-0012

FILE COPY

Rocky Mountain Arsenal Information Center Commerce City, Colorado

TABLE OF CONTENTS

Section I	Introduction
Section II	Construction Description
	A) Surface Facilities B) Plugging and Abandonment of Well
Section III	Productivity
	A) Schedule Durations B) Labor Distribution C) Contractor Percentage of Work
Section IV	Decontamination Procedures & Techniques
	A) Personnel Methods B) Equipment Methods - 1916
Section V	Operation Analysis
	A) Backfilling and Compaction B) Chemical Analysis of Materials
Section VI	Safety

			L
Accesio	n For		\
NTIS	CRA&I	}	J
DTIC	TAB	[
Unanno	ounced]
J ustific	ation		
By Distrib	ution /		
А	vailabilit	y Cod	35
Dist	Avail a Spe	and or cial	
A-1			

LIST OF FIGURES & APPENDICES

Figure 1	Contractor's Facilities, Rocky Mountain Arsenal Basin F
Figure 2	Construction Schedule-Estimated and Actual
Figure 3	Labor Distribution
Appendix 1	Backfilling and Compaction Results of Chen & Associates
Appendix 2	Results of Air Analysis by Hager Laboratories, Inc.
Appendix 3	Results of Chemical Analysis of Soil, Liquids, and Building Materials by Cenref Labs
Appendix 4	Certification of Post-Employment Medicals by Holly Clinic

SECTION I INTRODUCTION

At the beginning of July 1985, the Department of the Army, Contracting Division of the Rocky Mountain Arsenal, Commerce City, Colorado issued specification information under title of "Closure of Hazardous Waste Disposal Facilities at Basin F, Rocky Mountain Arsenal-Non-Personal Services." Solicitation number was DAAAO5-85-B-0008. A sealed bid was requested by July 24, 1985 at 1:00 pm with this finally being amended to July 29, 1985 at the same time.

Specifications were presented to Mr. Joseph Gerden, Vice President of Mining Division, by Mr. Paul Trost of MTA Resources, Inc. around the beginning of July, 1985. At the request of Mr. Gerden, Mr. Don Butler, Engineer and Estimator with Harrison Western Corporation, reviewed the specifications and a decision was made to bid on this project.

The bid opening indicated Harrison Western Corporation as low bidder at \$2,761,223.00 from a field of 4 bidders. There were two bidders which were higher and one withdrawal. On August 7, 1985 a third amendment was issued requesting a rebid as the initial figure was above the allotted budget. It was thought that revisions in the bid schedule would allow a contract price to fall within the Rocky Mountain Arsenal (RMA) budget. Harrison Western Corporation responded to the revised schedule on August 14, 1985 with a new contract price of \$1,840,548.00.

On August 30, 1985 Harrison Western Corporation was presented with a signed contract by Ms. Shirley Combs, Contracting Officer of Rocky Mountain Arsenal. A preconstruction conference was conducted at the same time so that all persons connected with the project could be introduced and the Notice to Proceed given. The contract duration was set at 150 days with liquidated damages beyond this time frame. The contractor was to begin within 10 days of Notice to Proceed.

Harrison Western Corporation was moving equipment and erecting site facilities by September 9, 1985. The project was staffed as follows: Paul Trost-Project Manager, Dennis Blanchette-Project Superintendent, Don Butler-Project Engineer, and Dan Johnson-Project Administrator.

Rocky Mountain Arsenal appointed Ms. Mary Curtin as Contract Administrator and Mr. Lloyd Howe as Contracting Officer's Representative.


SECTION II CONSTRUCTION DESCRIPTION

The project got underway on September 9, 1985 with the mobilization of equipment and materials to the Basin F site. Among the first jobs was to create work zones based on anticipated levels of contamination. The red or "Hot" zone comprised the entire work area and this was surrounded by posts connected by red flagging. Outside of the red zone was a yellow or "buffer" zone where employees followed procedures for lower levels of contamination. A support zone bordered the yellow area and comprised the rest of the site where equipment and employees were considered uncontaminated. The well was excluded from the red and yellow zone at the beginning so as to allow mobilization of equipment into this area without the requirements of respiratory safety apparatus. Inclusion into these zones took place on October 9, 1985.

Due to the complexity of the facility arrangement, and in order to comply with decontamination procedures it took 3 weeks to complete mobilization. Locker, shower, and lunchroom/safety trailers had to be utilized in a specific fashion which required an elaborate system of walkways to connect them.

A boot wash and laundry room complimented the trailer layout and completed the containment of contamination to the site proper. The following figure indicates the layout of contractor facilities at the Basin F site.

Utilities were provided by RMA but hookups were such that a fair amount Power was available from an of work was required to make connections. overhead 13.8 KV line but transformation was not allowed through the RMA New c-lines had to be installed Hot and another substation set substation. Additional transformers were installed to reduce voltage to 220 and 110 Water was obtained from the RMA potable water system throughout the site. after appropriate connections were made. PVC lines were laid in trenches to service all the trailers. Drinking water was provided in large plastic bottles by an independent local supplier. An existing telephone line which was broken in many places over 1-1/2 miles was repaired and strung to the contractor's office. This only lasted a few days due to its poor condition and location 5 feet below the 13.8 kv line. Electrical induction from the high voltage line yielded it inoperable. Mountain Bell looked over that section of the Arsenal and located an underground line in the vicinity of the

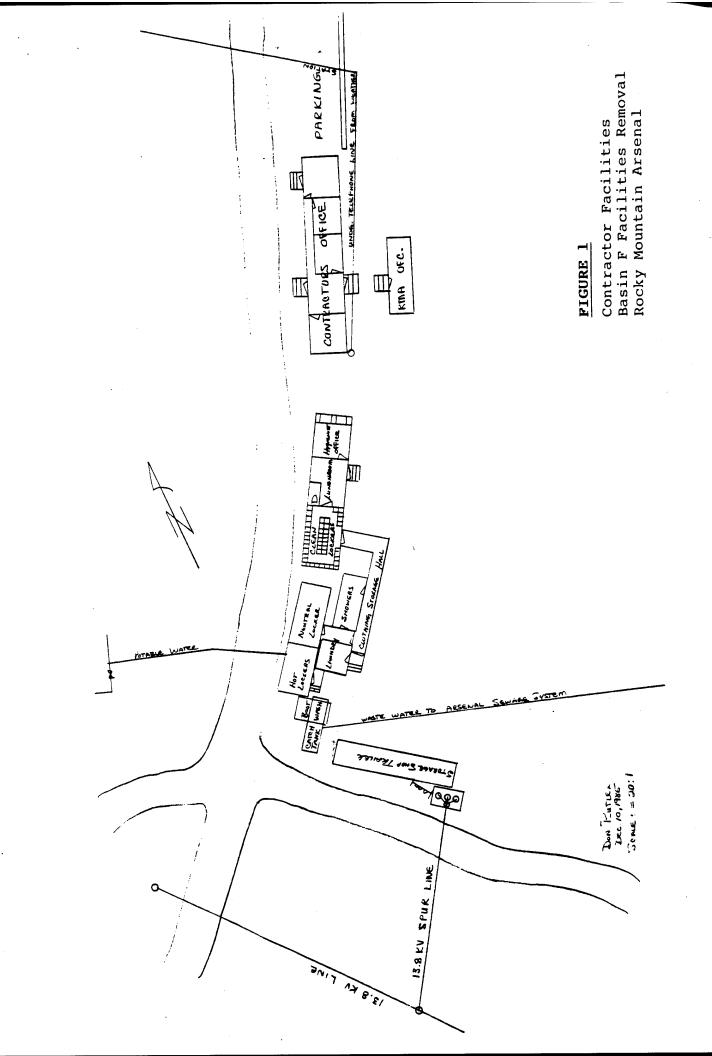

Basin F buildings. This line was tapped and laid underground to the weather station junction box. With the weather station inoperable throughout the contract two telephone lines were extended from the junction box to the contractor's office trailer.

Following completion of mobilization and utility connections the actual construction work was about to commence.

A. Surface Facilities

During the first three weeks of the project several small jobs began which would later take an active part in the construction process. In order to provide proper staging and a liquid containment area for the drill rig a 40 foot by 50 foot concrete pad was poured encompassing the wellhead. This pad as well as the sump would be removed later and properly disposed. The equipment washdown facility which existed at the job had to be enlarged to handle the long trucks which needed decontaminating. A 40 foot long by 25 foot wide slab was added to the existing slab and a new drain line installed to prevent liquids from draining into Basin F. The drain line flowed into the first of 3 settling tanks before entering a carbon filtration unit. The outlet of this carbon unit flowed into a pond for recycling use.

On September 30, 1985 after all preliminary work had been completed the site commenced work under "Hot" conditions. This meant that all employees working within the "Hot" or red zone had to be properly attired in protective suits and respirators. These people had to fully decontaminate any time they exited from this zone.

Before any major demolition could begin all contaminated liquids had to be removed from the sumps within or attached to the buildings. One crew of men set up a pump and hoses and began transferring liquids to the main clarifier tank. Because of the size of the clarifier this was used for storage. The transferring of liquids and flushing of these sumps with fresh water took approximately four days. This time may have been reduced if pumps more appropriate to this type of work had been utilized. Since working conditions involved contaminated liquids all men were equipped with continuous air flow breathing apparatus. Movement was restricted somewhat due to the trailing

airline but the increased comfort with this type of respirator more than made up for it.

Several large wooden rafts which had previously floated on Basin F were scattered throughout the site and needed to be disassembled. A four-man crew worked with torches and chainsaws to accomplish this job. Within four days all wood on the site had been cut and piled neatly in preparation for removal. Uncontaminated logs from a truck loadout facility were dug out and removed to a location near the Arsenal Fire Department. This took an additional day.

Three areas were staked out for stockpiling materials which would be produced during the demolition and excavation periods of the contract. One area to the east of the drainage ditch was cleared and plastic laid down for placement of contaminated soils. In the vicinity of building 802 an area was set aside for all metals cleaned up on the site and also an area for placement of all concrete materials. Separation of materials in this fashion allowed us to more accurately calculate volumes of each and hence approximate weights upon which disposal and transportation costs were based.

The rear walls of both buildings 802 and 806 were removed on September 30, 1985 to facilitate removal of all equipment labelled salvageable by RMA or HWC. A mechanical crew disassembled all the multiplex pumps and motors as well as their electrical starters and moved this gear to a location close to the wash down facility. All other miscellaneous salvageable equipment was removed to this location awaiting decontamination cleaning. Within five days both buildings were levelled to their foundations and the construction materials separated into their respective piles. At all times the site was maintained in a safe and orderly condition to minimize he possibility of minor injuries. Large front end loaders and backhoes were utilized to perform this demolition and experienced operators greatly contributed in the accomplishment.

Excavation of pipelines started on October 3, 1985 with the removal of a 73 LF section of pipe A&B between the fence and location F1. This section was considered contaminated by the COR in order that the Contractor's excavations would not be held up while waiting for a

soil removal decision by RMA. A change in the contract was to be received directing the Contractor not to remove and dispose of 9 cubic feet of soil per lineal feet of pipe as specified. A claim is pending for the removal and disposal of all pipes associated with the soil removal pay item.

On the second day the Caterpillar 225 excavator was moved to the 10 inch diameter clay tile line at manhole No. 2 and began excavation towards manhole No. 3. The same day the BE 325 excavator removed manhole No. 2 and excavated towards manhole No. 1. All material from this pipeline including 9 CF of soil per lineal foot of trench was removed and stockpiled for removal to a hazardous waste landfill. Since all remaining pipes were to be excavated without taking the soil the excavators were more or less turned loose and the majority of this work was completed by October 11, 1985. About 500 feet of pipe remained to be excavated in the area of the well but this would not be completed until the drill rig was removed from the site. soil were taken along the various trenches and sent for analysis. As the excavations progressed a wheeled loader backfilled and compacted the trenches. A soils testing subcentractor was employed to observe and test the backfilling for the required compaction. The results of these tests are presented in a later section.

Following completion of the pipelines both excavators were moved to the concrete foundation area and began excavation around these structures. A subcontractor's hydraulic breaker started demolition on October 11, 1985 and completed the main structures by October 15, 1985. The subcontractor was released from the site at this time and was recalled again on October 24, 1985 for an additional 3 days work in removing the clarifier, the well sump and drainage pad, and to assist in breaking some of the larger slabs. The slabs were reduced in size to ease handling and assure no damage to haulage trucks from the protruding rebar.

Between October 9, 1985 and October 15, 1985 all salvageable equipment and materials were processed through the decontamination facility. Some equipment was taken apart and later reassembled. All items were steam cleaned using a degreasing chemical soap and then

triple rinsed with a high pressure washer. Once decontaminated all equipment and miscellaneous metal materials were stored in the field bordering the yellow zone awaiting inspection and release by the COR.

With the removal of most facilities complete by October 15, 1985 work now centered around cleaning up the site, organizing stockpiled materials, filling excavation holes, grading the site, and providing backup work for the drill rig and crew. Excess soil piles which were located to the southeast of the washdown facility were moved and used for excavation fill.

On October 23, 1985 the first 10 trucks from U.S. Pollution Control, Inc. arrived and were loaded with solid waste materials. These materials were transported to their Utah hazardous waste landfill site. Solid waste was loaded and removed each day until November 2, 1985. Trucks were not supplied in the numbers quoted by the Subcontractor and thus caused a delay in our schedule. Tankers finally arrived on November 3, 1985 and with a couple a day this work was complete by November 12, 85. These trucks moved liquids from RMA to an Oklahoma HWLF. This portion of the project was exercised extremely well but the reduction of the average number of trucks per day from 18.0 to 5.5 greatly extended this later schedule item.

B. Plugging and Abandonment of Well

This portion of the contract required a quantity of specialized equipment due to the nature of the work and the depth of the well. In order to handle all operations within the well required a rig capable of 12,000 to 15,000 foot depth. Exeter Drilling Company was contracted to provide their rig No. 69 to perform these specialized operations for HWC. The rig was mobilized on site on October 7, 1985 and set-up. Safety training and physicals were conducted the next two days and work was scheduled to start on October 10th.

In preparation for the plugging procedures the mud tanks were filled and mixed and the rat hole drilled. The next step was the preparation of the Blow Out Preventer (BOP) which was speared and hung above the collar works. This would be installed after the 5.5 inch casing slips were unseated. The inside of the 5.5 inch casing was

scraped at the collar, speared, and pulled to 200,000 lbs. in an effort to free the slips. When this initial pull didn't work, the collar at the slip location was heated twice with torches and hammered. A second pull at 210,000 pounds freed the slips and upon increasing this to 225,000 pounds the casing slipped from the packer. At this point the BOP was lowered and installed and hooked up for reverse circulation. Approximately 500 barrels of fresh water was pumped into the annulus with only a partial return which indicated that the 5.5 inch casing was likely plugged with the fish. Circulation pressure started at 400 pounds, was reduced to 200 pounds and finally lowered to 75 pounds.

Because of poor circulation up the 5.5 inch casing it became apparent that this would likely be a "wet-pull" and therefore the crews were suited appropriately. This meant continuous air flow respirators. The first joint of tubing was removed at 6:25 pm on October 11th and the entire string of 9,000 feet was completely removed by 8:15 am on October 13th.

The next step was to mill the packer from its location. The 4.5 inch mill was rigged up and following tripping in the hole the operation started at 9:30 pm on October 1*th. About 6 inches of the 3 feet had been milled when the rig was shut down by RMA due to a suspected chemical burn to one of the rig hands. Some 14 hours later work resumed on the milling of the packer. This work was completed without any further interruptions and the packer fished from the well.

codition?

Another subcontractor, NL McCullough, had set up their rig by 10:00 pm on October 15th and began a cement bond log of the hole. This was complete by 8:00 am the following morning. A casing inspection log was scheduled next but this could only be completed to the 10,052 foot level. A tight spot was intersected at this level and the special tool wouldn't pass. At this point a decision was made to run a gauge ring tool in conjunction with a junk basket. This ring tool went as far as 11,002 feet into the well and stopped. It was pulled up to 8,900 feet and sent down again before stopping at the same location. During retrieval from the hole 4,700 feet of wire line cable was destroyed when it became ravelled by a split in the casing. This was cut off and discarded.

A decision was made to scrape this section of the casing from 9,000 feet to 11,002 feet and run another inspection log. The log was run with sinker bars to check for bridges in the lower 5.5 inch The stinger was stopped at the 11,916 foot level when a solid bridge was hit and this raised some concern as this was 129 feet short of the supposed hole bottom. After tripping out of the hole a 4.5 inch bit with jars on 2-7/8 inch tubing was assembled and proceeded to run to the bottom. Some junk in the hole was intercepted at 11,914 feet and chased down the hole to 11,938 feet where it lodged. Bad torque in the drill string was recorded when the bit made contact with this bridge so the entire string was retrieved and the 4.5 inch bit replaced with a 4.25 inch flat bottom milling tool. After reaching this level of the well again the junk was milled and pushed down the hole to the 11,982 foot level. This point was 7 feet below the bottom of the lower 5.5 inch casing so once the junk reached 11,975 feet it fell to the bottom. The drill string was pulled up into the lower casing and drill mud circulated for 3.5 hours. The mud combined with a fresh water gel had a viscosity of 38 to 40. Following this circulation of mud the milling equipment was retrieved from the well. This portion of the P&A was completed by 10:30 am on October 20th.

The next major step in the plugging and abandonment of the well involved the setting of a cement retainer. A Baker 5AA Model K-1 cement retainer was set by the NL McCullough wireline crew at the 10,957 foot level. Following withdrawal of the wireline the crews tripped into the hole with the retainer stringer and prepared for cementing. Dowell-Schlumberger was set up and fresh water was circulated through the drill tube. After the cement was mixed it was placed below the retainer at pressure ranging from a maximum of 1400 pounds to the final pressure of 650 pounds. This plug took 120 sacks of Class "G" cement combined with 3/10% D-28 retarder and 35% D-66 silica flour. An additional 26 feet of cement was placed on top of the retainer. It was a successful squeeze. The cementing equipment was removed from the hole and a Baker RTTS was rigged up for pressure testing the casing. This tool was lowered into the well to the 1530 Pressure was applied to the casing bore in foot level and set. increments from 600 pounds to 725 pounds over a period of 1 hour 35

minutes. The casing tested as being in good condition with a maximum pressure of 5,848 pounds at the 10,957 foot level. This amount was 80 percent of the internal yield pressure of 8-5/8 inch N80 casing. This packer was removed from the well and open-ended drill tubing lowered again for circulation of muds.

Drill muds from within the 8-5/8 inch casing were displaced to a frac tank as it was thought it may be contaminated. Mixing of appropriate abandonment muds was started and on October 22nd the mud was placed from 10,931 feet up to 4,600 feet. This mud had a weight of 9.5 pounds per gallon, a viscosity of 45, a pH of 8.0 and was combined with a fresh water gel. Due to the possible split in the 8-5/8 inch casing at 4,492 feet it was decided to place a cement plug between 4,600 feet and 4,400 feet. Western Cementers were rigged up and 57 sacks of Class "G" cement with a 3/10% WR-15 retarder were placed. This cement had a weight of 15.6 pounds per gallon for a yield of 1.18 CF per sack. Abandonment mud was mixed for the well section from 4,400 feet to 1,530 feet where the Cast Iron Bridge Plug would be placed. This mud was placed early on October 23rd. It had a weight of 9.5 pounds per gallon with a viscosity of 85 and a pH of 8.0.

The Baker 5AA Model N-1 cast iron bridge plug was set by the NL McCullough wireline crew at the 1,530 foot level. Much discussion ensued regarding the cement bond log and the possibility of squeezing cement through a perforated casing from the 1530 foot level to the top of the well. Based on the opinion of EPA representative Paul Osborne the cementing of the well was completed as per the original plan. This work was finished at 8:00 am on October 24th. Cleanup work started immediately with the emptying of muds from the agitator tanks into frac tanks. All drill tubing was removed from the racks and decontaminated at the washdown area. Disassembly of the rig started in the afternoon of October 24th and after movement to the washdown facility, decontamination of all segments, and removal to the support area was completed by noon of October 27, 1985. At this time the subcontractor was released.

c Mra

After the cement drainage pad and sump were removed, the excavation was backfilled and the marker posts installed. Requirements for a printed marker could not be confirmed so the contractor was relieved of this responsibility.

SECTION III PRODUCTIVITY

The Rocky Mountain Arsenal project commenced on September 9th with a slight fear that productivity was surely to suffer due to restrictions placed on the workers. Special clothing had to be donned each day and changed at lunch time after a full decontaminaton procedure. The fact that everyone had to wear respirators on all jobs wasn't appealing but the crews were ready to face the challenge. Weather was another factor that was inevitable in these later months of the year and the schedule very much depended upon its cooperation.

The contract had a performance duration of 150 days in order to avoid liquidated damages but the Contractor proposed a schedule which was 87.5 days. A work week of 5 days at a single shift was proposed but the idea of working weekends or longer hours in order to meet the schedule was not ruled out.

A. Schedule Durations

Despite the restrictions mentioned above, productivity suffered very little over the duration of the project. Wherever possible mechanical equipment was utilized to reduce physical labor. Morale remained exceptionally high under these conditions and this was attributed to the caliber of workers selected. Experienced miners and equipment operators who were used to working under hazardous conditions were recruited for this work. Crews were kept small and all men worked well together. A production safety bonus was established for all employees and this proved beneficial in maintaining our schedule.

The proposed 87.5 day schedule was beaten and the proejct was completed in 68 days. This duration amounts to 77.7 percent of the proposed schedule and 45.3 percent of the contract allotted time. The estimated and actual durations of construction operations are shown in Figure 2.

ROCKY MOUNTHIN AKSENAL -- BESIN F CLEANUP

SUMMARY SCHEDULE - 1985

	DECEMBER		Estura R.D.	
	· ·			FIGURE
	-	97 J		
	E 	9	Horan Front	
	-		1	
-	+			
	+		T T T T T T T T T T T T T T T T T T T	
	CCTOBLLY		I I I I	
	- 1	a IIIIII į		are berebule
· ! ;		87 - 1 1 1		HELIANE DIMENTION & SCHELLINE ESTIMATED DURATION & SCHEDULE
; ;)		ī I	·	HEIUNE BURNTION &
	5	4		Per
l F		SAT. — 07		
	2 47		<u> </u>	1 114
	DESCRIPTION	SURFFICE FACILITIES MUBLIZE SITE CONSTRUCT DECON.FACILITY & PMS LIQUID DKPOSAL TO CLARIFRE LIQUID CLEANUP BUILDING DEINOLITION CUNTRACTOE SALVAGE MISA · METAL CLEANUP FILL 4 COMPACT EXCAVATIONS HAULING BACKFILL ZOAD HWIF TRUCKS & CLEANUP & KADE SITE	LUELL- PLUG + ABANDONMENT INDRILIZE DRILL RIG ZINSTAIL BOP, TEST, REV. CIR. SPEAR + PULL CASINGA INILL - 2045 IF MILL + RETRIEUE PACKER BOCKAPE CASINGA TOLEANOUT LUELL PRESSURE TEST CASINGA LOS CEMENTING OPERATIONS DEMOR 1 DECONTAMINATE RIG THE MORILIZE SITE	

B. Labor Distribution

During the project HWC had the operation staffed by 4 people. The Contractor's employees were mainly responsible for the demolition and removal of permanent Basin F facilities, maintenance of construction site facilities, and backup work for the drill rig crews. Maintenance of construction facilities was not solely limited to cleaning of trailers and repairs/lube of equipment but all clothing had to be laundered for single shifts during the entire project and three shifts during the P&A of the well.

Original plans called for a fairly stable number of employees throughout the job with peak periods being covered by overtime. This worked out extremely well. The number of subcontractor employees varied drastically between certain phases of the project.


Figure 3 which follows shows the Contractor and Subcontractor labor distribution throughout the project.

C. Percentage of Work

By the requirements of the contract HWC was to perform at least 25 percent of the work on the project unless it was requested of the Contracting Officer that this amount be reduced. This project required several areas of specilization which were either beyond the realm of our organization or it was more cost beneficial for the amount of work concerned to be done by a Subcontractor.

Subcontractor work was performed by the following organizations.

- Chen & Associates Backfilling observation, compaction and soil analysis.
- 2. Power Breaking, Inc. Demolition of concrete foundations.
- 3. Spence-Geiger Associates, Inc. Industrial hygienist support for the project duration as well as contamination monitoring.

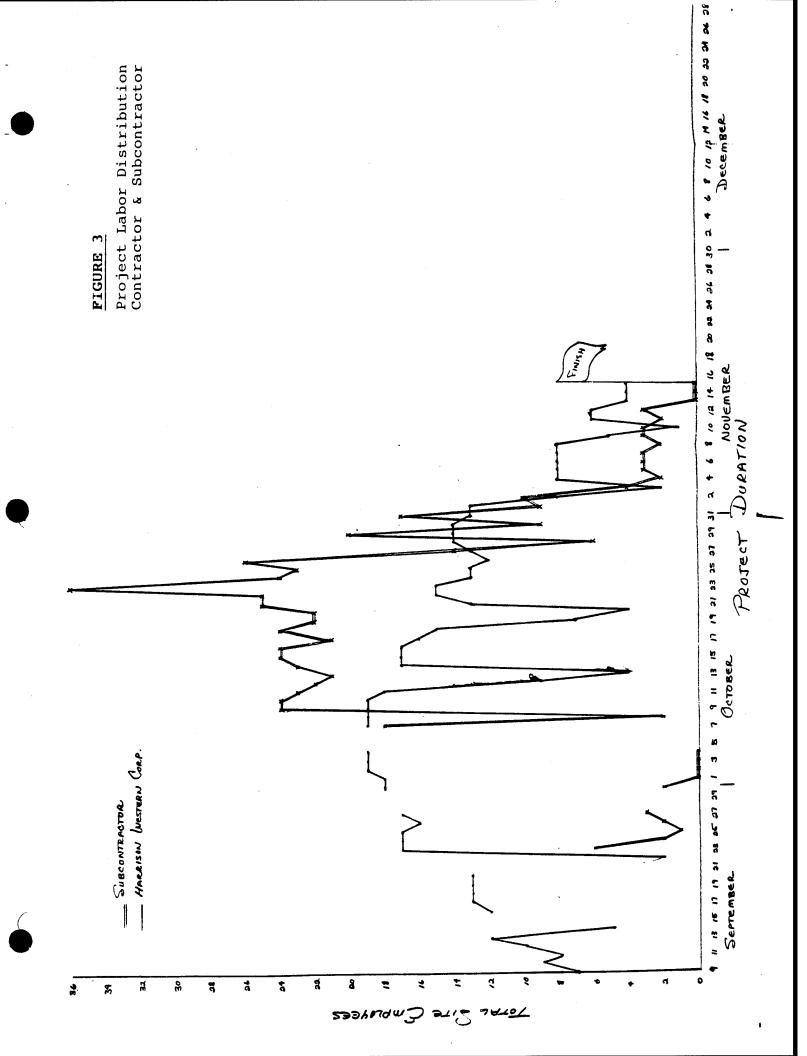

- 4. Exeter Drilling Company Provided equipment and expertise in the plugging and abandonment of the well.
- 5. U.S. Pollution Control, Inc. Provide haulage and disposal of all contaminated materials to an out-of-state hazardous waste landfill (HWLF).
- 6. Conref Labs, Hager Laboratories Both these laboratories provided analysis of air as well as construction materials and liquids.
- 7. NL ACME Tool Provided specialized tools and consultation in the P&A of the well.
- 8. NL McCullough With several different specialized tools they provided inspection logs of the well condition.
- 9. Baker Service Tools This company rented special tools for pressure testing of the well casing and also provided the abandonment cement retainer and bridge plug.
- 10. Dowell-Schlumberger Provided consultation and equipment for the placement of the bottom well cement plug below the 10,957 foot level.
- 11. The Holly Clinic Provided all medical examinations, analysis, and certifications prior to the job starting and at completion.

The final billings of all these subcontractors as a percentage of the total anticipated billing of HWC to the Department of the Army at RMA is equal to 32.15 percent. Therefore the Contractor has fallen well within the bounds of contract specifications by completing 67.85 percent of the work.

SECTION IV

DECONTAMINATION PROCEDURES & TECHNIQUES

The methods of decontamination of personnel and equipment was fairly well dictated by the contract specifications but the arrangement of these facilities was somewhat at the discretion of the Contractor. The criteria was wholly dependent on the sizing and configuration of the various equipment used.

A. Personnel Methods

Upon leaving the "Hot" and "Neutral" working zones each employee had to proceed through a decontamination process that was specifically outlined in the Contractor's Safety and Training Manual. Each person would step into a boot wash area where their rubber boots would be rinsed of mud and contaminants. This area was a translucent plastic panel enclosed shelter equipped with a water hose and spray nozzle. Fluids from this area drained into a catch basin. Respirators and rain gear were also rinsed here prior to entering the "Hot" locker area. In this locker room employees stripped of all gear. Boots, raingear, and hard hats were stored in individual lockers while all garments were bundled together and tagged with an employee's number. As the employee left this locker room for the shower room the bundle of clothes and respirator were taken and deposited through a laundry room trap door.

In the laundry room an employee washed each bundle of clothes in detergent and bleach. Following drying, the individual's bundle was hung on a hook in the hallway under a number corresponding to the tag number on the bundle. Each respirator was washed in soapy water and rinsed with a disinfectant prior to an inspection. If any portion of the respirator was in fault, it was removed from service and given to the hygienist for repairs. All respirators which passed inspection were thoroughly dried, placed in clear plastic bags and put on a shelf above the corresponding number in the hallway. The laundry room was kept busy since men were changing clothes at lunch time, end of shift, or whenever their clothes were wetted while working.

The shower trailer operated with a negative pressure system in the Step-In side which directed contaminants away from the positive pressure clean side (Step-Out) whenever the shower door was opened. A small problem existed in the beginning with the propane fired water heaters. Due to the surrounding of this trailer with other higher structures outside air currents suppressed the exhaust of the heaters and extinguished the pilot lights. This problem was solved by attaching an exhaust vent tube which extended above the roofline.

Employees started drying themselves after stepping out of the shower and completed as they walked down the heated hallway to the "Clean" locker room. Personal clothes were retrieved from the individual's locker and used towels discarded in a plastic basket for laundering. This locker room adjoined the lunchroom and the hygienist's office where each person checked out. The reverse process with the exception of showering took place at the beginning of the day and after lunch. The decontamination process took place at lunch and the end of their daily shift.

B. Equipment Methods

The expanded washdown facility was re-equipped with a steam cleaner and high pressure washer to handle all the decontamination of equipment. A Landa steam cleaner, model PSC3-300 was used to provide initial cleaning of most equipment. This machine operated with a pressure of 300 psi at 315°F and discharged at a capacity of 2.5 gallons per minute. Combined with a heavy duty degreasing agent this machine did a very effective job. The high pressure washer which complemented this operation was also provided by Landa. This machine was a model PHW4-2000 which had a discharge capacity of 4 gallons per minute at 2000 psi. It operated at 200°F.

Most equipment which operated on the site remained within the "Hot" zone at all times. On occasion equipment was required in the support area so they were taken to the washdown facility for decontamination. Once on the cement pad it was steam cleaned to remove any soil and contaminants which would cling to greasy parts. Following a thorough cleaning, the high pressure washer was used to triple rinse

the piece of equipment. The initial decontamination of a piece of equipment was the worst as years of crud had to be removed. Repeated trips through the facility rendered the gear in spotless shape.

In the process of plugging and abandoning the well a large quantity of drill tubing was used or recovered in the process. This tubing required some special method for decontaminating the interior so an apparatus was developed. Two twenty foot lengths of 1 inch diameter steel pipe were coupled together and attached to the steam cleaner or washer hose at one end. A 5 inch diameter wire brushing disk was brazed to a short nipple and attached with a coupling to the other end of the pipe. The open end past the wire disk was capped. Several small holes were placed in the pipe close to and facing the wire disk. Cleaning worked quickly and efficiently with this set-up. All other equipment were cleansed with a trigger operated wand on the end of the hose.

SECTION V OPERATIONAL ANALYSIS

Contract specifications required that the Contractor retain a commercial testing laboratory to conduct field tests to insure proper soil densities during backfilling. No additional testing was required, however, the Contractor chose to analyze soils and liquids involved in the cleanup process. Monitoring for contaminants took place on a daily basis by the industrial hygienist and some specific air samples were taken for analysis.

A. Backfilling and Compaction

The independent laboratory chosen by the Contractor was a reputable firm of Consulting Geotechnical Engineers named Chen & Associates from Denver, Colorado. They were requested to be on site full time during the backfilling of pipe and building excavations and to conduct density tests as they deemed necessary in all areas. Mr. Kevin McNeill represented the firm as their on site Field Engineer. The results of these tests are presented in Appendix 1.

B. Chemical Analysis of Materials

A sample of air collected from the site was taken to Hager Laborities, Inc. of Denver for gas chromatographic analysis. Testing was conducted to determine concentrations of the compounds Aldrin and Dieldrin. Results of their analysis are presented in Appendix 2.

Numerous samples of soils, liquids, and building materials were collected during the removal fo the Basin F facilities of which several were analyzed. This analysis was performed by Conref Labs of Brighton, Colorado Test results are presented at the end of this report in Appendix 3.

SECTION VI SAFETY

Safety was a major concern to HWC throughout this project primarily because this type of work was unique in regards to the handling of hazardous materials. Employees were selected that had previous experience working under potentially dangerous conditions and all received in depth training for this situation. At no time during the project was safety foresaken for production. The specialized safety training and daily reminders greatly reduced the potential for accidents. The hazards in this type of work were enormous but the project was completed with only one lost time accident and several small incidents. One employee received a broken lower leg while laying down heavy drill tubing after decontamination and several others received scratches or punctures from mails when cutting and piling scrap wood. These injuries were either treated at the hospital or the industrial clinic.

On three occasions minor cases of heat exhaustion were observed and treated. Highly productive employees had to be reminded often to slow down their work habits when they were fully suited in hazardous protective clothing. This type of clothing does not breathe freely so body heat is retained.

Medical examinations were compulsory for all site personnel prior to beginning work at RMA as well as upon completion of the job. Certification of pre-employment physicals have been submitted to the COR with the weekly reports and the certification of post-employment medicals is attached in Appendix 4.

DJB:b1:94-1

APPENDIX 1



96 South Zuni Denver, Colorado 80223 303/744-7105

Casper Cheyenne Colorado Springs Glenwood Springs **Rock Springs** Salt Lake City

October 23, 1985

Subject: Fill Observation and Testing, Disposal of Hazardous Waste, Facilities at Basin F, Rocky Mountain Arsenal, Commerce City,

Colorado.

Job No. 1 940 85

Mr. Don Butler Harrison Western Corporation 770 Sims Street Denver, Colorado 80401

Dear Mr. Butler:

As you requested, we visited the subject site and began full-time fill observation and testing on October 7, 1985.

During the observation period, we sampled the fill materials. The materials were tested in our field laboratory for determination of moisture-density relationships in accordance with ASTM procedures. The results of our laboratory tests are presented in the attached figures.

Nuclear density tests were conducted at several areas within the compacted fill. The specifications for fill placement were provided by your The results of these tests are presented in the attached daily office. reports.

We are available to continue part-time or full-time fill observation and testing at your request. We will provide daily reports summarizing all test results. If you have any questions concerning the observation reports, please contact us.

Sincerely,

Chen & Associates, Inc.

Rev. By: DMJ DMD/ram Enclosures

. . .

Harrison Western Corporation Denver, Colorado 80401 770 Sims Street

٩

Attention: Mr. Don Butler



Chen & Associates Consulting Geotechnical Engineers

Date 10/7/85 Job No. 1 940F 85

ō Sheet Daily Report No. 1

Facilities at Basin F, Rocky Mountain Disposal of Hazardous Waste, Subject: Construction Activities Report Arsenal, Denver, Colorado.

> Sunny, 60's. WEATHER CONDITIONS AND TEMPERATURE

CONTRACTORS EQUIPMENT

At the time of return to the site for possible testing. At the time of our second visit, fill was still not prepared for testing. Mr. time. Mr. Don Butler of Harrison Western requested our personnel to report to the Holly Clinic for a CHE Test and then our arrival, fill had not been placed for density testing and a respirator for our personnel was not available at this CONSTRUCTION ACTIVITIES At the request of Mr. Don Butler of Harrison Western Corporation, we visited the site on this date. Butler requested us to return on October 8, 1985.

VERBAL COMMUNICATION WITH CONTRACTOR, ENGINEER, ARCHITECT, OWNER

COPIES:

FIELD OBSERVER Kevin McNeill

David M. Dix/ram APPROVED BY

Harrison Western Corporation Denver, Colorado 80401 770 Sims Street 10

Attention: Mr. Don Butler



Chen & Associates Consulting Geotechnical Engineers

10/8/85 Date 1 940 85 Job No.

ŏ Sheet 7

Daily Report No.

Facilities at Basin F, Rocky Mountain Disposal of Hazardous Waste, Subject: Fill Observation and Testing Arsenal, Denver, Colorado.

		ПЕРТН	LABOI	LABORATORY	FIELD	9		
TEST NO.	LOCATION	OR OR ELEVATION (FEET)	MAXIMUM DRY DENSITY (DCI)	OPTIMUM MOISTURE CONTENT (%)	DRY DENSITY (pcf)	MOISTURE CONTENT (%)	PERCENT COMPACTION	SOIL TYPE
-	100'S of Building 802, 10" Clay Tile Line from Little Basin F	52	126.9	8.8	110.9	10.7	87	Clavev Sand
2	250'S of Building 802, 10" Clay Tile Line from Little Basin F	1'BRG	126.9	8.8	114.1	11.5	06	Clayey Sand
٣	350's of Building 802, 10" Clay Tile Line from Little Basin F	2-1/2' BRG	126.9	8.8	110.3	10.7	87	Clavev Sand
4	400'S of Building 802, 10" Clay Tile Line from Little Basin F	1'BRG	126.9	8.8	111.7	6.6	88	Clayev Sand
Z	500's of Building 802, 10" Clay Line Line from Little Basin F	1-1/2' BRG	126.9	8.8	112.2	8.5	88	Clayey Sand
					-			

85% modified Proctor SPECIFICATION COMPACTION & MATERIAL density.

TYPE AND NUMBER OF EARTH MOVING UNITS (2) Backhoes, (1) Dozer, (1) Loader TYPE AND NUMBER OF COMPACTION UNITS Wheel Rolled with Loader 3 Approx. THICKNESS OF LIFT Natural As Req'd. METHOD OF ADDING MOISTURE NUMBER OF PASSES

This report presents opinions formed as a result of our observation of till placement. We have relied on the contractor to continue applying the recommended compactive effort and moisture to the fill during times when our observer is not observing operations. Tests are made of the fill only as believed necessary to calibrate our observer's judgement. Test data are not the sole basis for opinions on whether the fill meets specifications.

COPIES

CAF-1R (6-85)

(X FILL TESTED MEETS SPECIFICATIONS.

FILL TESTED DOES NOT MEET SPECIFICATIONS AS INDICATED BY TEST

AND SHOULD BE REMOVED OR REWORKED.


(X CONTRACTOR ADVISED

☐ PART TIME OBSERVATION LX FULL TIME OBSERVATION

The results are presented PROGRESS REPORT All of the tests taken on this date are A sample of the backfill material was obtained to determine the located in the removed pipe trench backfill. moisture-density relationships. in the attached figure.

FIELD OBSERVER Kevin McNeill

David M. Dix/ram APPROVED BY

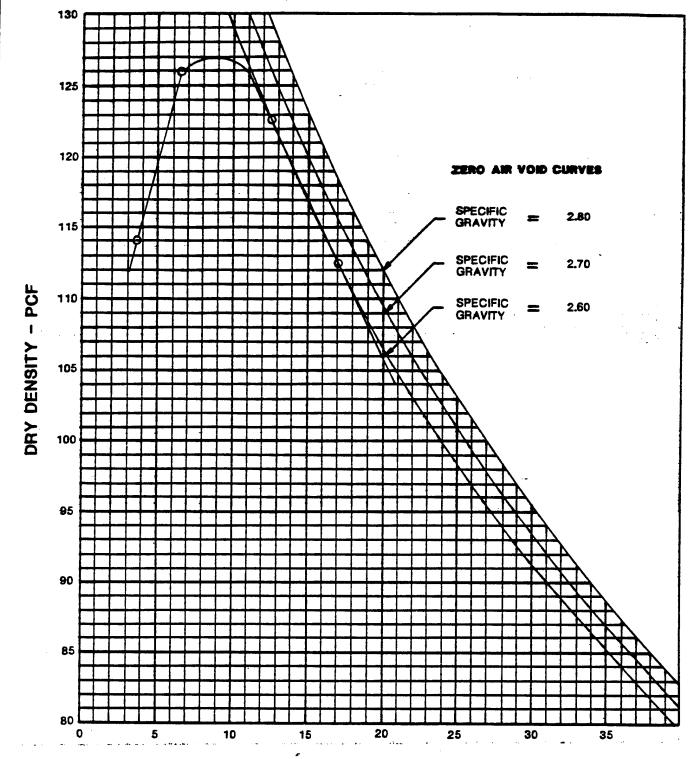

MOISTURE CONTENT - PERCENT OF DRY WEIGHT

LOCATION: 10*	Clay Tile L	ine from Little Basin F		MOISTURE-DENS	SITY
HOLE NO. :	DEPTH:	SAMPLE NO. :		RELATIONSHIP	S
SOIL DESCRIPTION	:Clayey Sand			Chen & Associa	ites
MAX. DRY DENSITY	126.9 PCF	OPT. MOIST. CONTENT : 8.8	. %	PROCEDURE : ASTM D-1557-78	Method A
LIQUID LIMIT :		PLASTICITY INDEX :		JOB NO.: 1 940F 85	FIG. NO.
GRAVEL: %	SAND:	% SILT AND CLAY (-200) :	_%	DATE: 10/8/85	1

To Harrison Western Corporation 770 Sims Street Denver, Colorado 80401

Attention: Mr. Don Butler



Chen & Associates Consulting Geotechnical Engineers

Job No. 1 940 85 Date 10/9/85

ŏ

Sheet

Daily Report No.

Subject: Fill Observation and Testing Disposal of Hazardous Waste, Facilities at Basin F, Rocky Mountain Arsenal, Derver, Colorado.

		111410	LABO	LABORATORY	FIELD	٥			Г
LOCATION		DEPTH OR ELEVATION (FEET)	MAXIMUM DRY DENSITY (pcf)	OPTIMUM MOISTURE CONTENT	DRY DENSITY (pcf)	MOISTURE CONTENT (%)	PERCENT COMPACTION	SOIL TYPE	
5'N and 20'W of	ŀ	- Carl	0 901	0		Г	6		
No Corner, Bullaing 800, H-Line 5'N and 40'W of	1	1-1/2'	6.07	8.8	112.3	۱.6	88	Clayey Sand	
NE Corner, Building 806, H-Line		BRG	126.9	8*8	110.7	6.9	87	Clayey Sand	
NW Corner, Building 806, G-Line		1'BRG	126.9	8.8	111.7	7.5	88	Clayey Sand	
20'N and 100'W of									
NE Corner, Building 806, G-Line		1 BRG	126.9	8.8	113.4	6.8	88	Clayey Sand	
NE Corner, Building 806, G-Line		2'BRG	126.9	8.8	112.1	7.2	88	Clayey Sand	
50 W of									
NE Corner, Building 806, J-Line	_	1 BRG	126.9	8.8	110.4	7.1	87	Clayey Sand	
100'W and 15'E of	<u> </u>								
NE Corner, Building 806, K-Line		3'BRG	126.9	8.8	111.6	6.5	88	Clayey Sand	

(* FILL TESTED MEETS SPECIFICATIONS. 85% modified Proctor Unknown THICKNESS OF LIFT TYPE AND NUMBER OF EARTH MOVING UNITS (2) Backhoes, (1) Dozer, (1) Loader Natural TYPE AND NUMBER OF COMPACTION UNITS SPECIFICATION COMPACTION & MATERIAL density. As Reg'd. METHOD OF ADDING MOISTURE Wheel Rolled with Loader NUMBER OF PASSES

This report presents opinions formed as a result of our observation of till placement. We have infled on the contractor to continue applying the recommended compactive effort and mosture to the fift during times when our observer is not observing operations. Tests are made of the fill only as believed necessary to calibrate our observer's judgement. Test data are not the sole basis for opinions on whether the fill meets specifications.

COPIES

	6.85
l	Ē
	AF.
İ	ũ

☐ FILL TESTED DOES NOT MEET SPECIFICATIONS AS INDICATED BY TEST NO.(S) AND SHOULD BE REMOVED OR REWORKED. EX CONTRACTOR ADVISED LX FULL TIME OBSERVATION ☐ PART TIME OBSERVATION	PROGRESS REPORT All of the tests taken on this date are located in the removed pipe trench backfill.
---	--

David M. Dix/ram

APPROVED BY

FIELD OBSERVER

Kevin McNeill

Harrison Western Corporation 770 Sims Street Denver, Colorado 80401

9

Attention: Mr. Don Butler



Chen & Associates
Consulting Geotechnical Engineers

Job No. 1 940 85 Date 10/10/85 Daily Report No. 4 Sheet 1 Of 2

2

Subject: Fill Observation and Testing Disposal of Hazardous Waste, Facilities at Basin F, Rocky Mountain Arsenal, Denver, Colorado.

											ĺ			
	SOIL TYPE	Silty, Clayer Sand		Silty, Clayey Sand		Silty, Clayev Sand		Silty, Clavev Sand		Silty, Clayev Sand		Siltv, Clavev Sand		Silty, Clayey Sand
	PERCENT	89		06		68		88		98		87		87
FIELD	MOISTURE CONTENT (%)	11.5		11.1		12.5		13.5		12.1		12.6		12.0
H	DRY DENSITY (pcf)	106.3		107.4		105.9		104.8		102.7		103.5		104.1
LABORATORY	OPTIMUM MOISTURE CONTENT (%)	13.1		13.1		13.1		13.1		13.1		13.1		13.1
LABOF	MAXIMUM DRY DENSITY (pcf)	119.4		119.4		119.4		119.4		119.4		119.4		119.4
DEPTH	OR ELEVATION (FEET)	3 'BRG		2'BRG		P.G	2-1/2'	BRG		B C		1'BRG		3'BRG
		B-Line		B-Line		B-Line		0-Line		P-Line		N-Line		M-Line
·	LOCATION	25'W of SE Corner of Building 802, B-Line	125'W of	SW Corner of Building 802, B-Line	275 W of	SE Corner of Building 802, B-Line	50'W of	NW Corner of Building 802, O-Line	20'N and 3'W of	NW Corner of Building 802, P-Line	10'N and 15'W of	NE Corner of Building 802, N-Line	20'N of	NW Corner of Building 802, M-Line
	TEST NO.	13 SE		14 SW	27	15 SE	20	16 NW	20	17 NW	10	18 NE	20	19 MN

SPECIFICATION COMPACTION & MATERIAL 85% modified Proctor density.

TYPE AND NUMBER OF EARTH MOVING UNITS

(2) Backhoes, (1) Dozer, (1) Loader

TYPE AND NUMBER OF COMPACTION UNITS

Wheel Rolled with Loader

NUMBER OF PASSES As Reg'd. THICKNESS OF LIFT Unknown

METHOD OF ADDING MOISTURE Natural

This report presents opinions formed as a result of our observation of filt placement. We have relied on the contractor to continue applying the recommended compactive effort and moisture to the fill during linnes when our observer is not observing operations. Tests are made of the fill only as believed necessary to calibrate our observer's judgement. Test data are not the sole basis for opinions on whether the fill meets specifications.

l	
ŀ	C.
	9
i.	

CAF: 1R (6:85)

M FILL TESTED MEETS SPECIFICATIONS.

THE TESTED DOES NOT MEET SPECIFICATIONS AS

FILL TESTED DOES NOT MEET SPECIFICATIONS AS INDICATED BY TEST

AND SHOULD BE REMOVED OR REWORKED.

A CONTRACTOR ADVISED TO FULL TIME OBSERVATION

FULL TIME OBSERVATION

| PART TIME OBSERVATION

PROGRESS REPORT All of the tests taken on this date are located in the removed pipe trench backfill. A sample of the backfill material was obtained to determine the moisture—density relationships. The results are presented in the attached figure.

| Kevin McNeill | David M. Dix/ram | FIELD OBSERVER | APPROVED BY

Harrison Western Corporation Denver, Colorado 80401 770 Sims Street 2

Attention: Mr. Don Butler



Chen & Associates Consulting Geotechnical Engineers

Date 10/10/85 Job No. 1 940 85

ō 7 Sheet 4 Daily Report No.

8

Facilities at Basin F, Rocky Mountain Disposal of Hazardous Waste, Subject: Fill Observation and Testing Arsenal, Denver, Colorado.

		OFFILE	LABOI	RATORY	出出	FIELD		
TEST NO.	LOCATION	OR OR ELEVATION (FEET)	TION DRY MOISTURENT CONTENUIN PRINCIPLING CONTENUIN (96)	OPTIMUM MOISTURE CONTENT (%)	DRY DENSITY (pcf)	MOISTURE CONTENT (%)	PERCENT COMPACTION	SOIL TYPE
20	15'N and 20'E of NW Corner of Building 802, F-Line	5'BRG	119.4	13.1	105.5	10.7	88	Silty, Clayey Sand
21	20'N and 20'E of NW Corner of Building 802, F-Line	RG	119.4	13.1	106.1	11.3	89	Silty, Clayey Sand

SOIL TYPE	Silty, Clayey Sand	Silty, Clayey Sand				FILL TESTED MEETS SPECIFICATIONS. FILL TESTED DOES NOT MEET SPECIFICATIONS AS INDICATED BY TEST	KED.		PART TIME OBSERVATION			
PERCENT COMPACTION	88	89				CATIONS. :T SPECIFIC	NO.(S) AND SHOULD BE REMOVED OR REWORKED.		□ PAR1			
MOISTURE CONTENT (%)	10.7	11.3				FILL TESTED MEETS SPECIFICATIONS. FILL TESTED DOES NOT MEET SPECIF	REMOVED (VISED	WATION			
DRY DENSITY (pcf)	105.5	106.1				STED MEE STED DOE	HOULD BE I	X CONTRACTOR ADVISED	FULL TIME OBSERVATION	S DEBOOT		
OPTIMUM MOISTURE CONTENT (%)	13.1	13.1				IX FILL TE	NO.(S) AND SP		(X FULL T	PBOCEES BEDOET		
MAXIMUM DRY DENSITY (pcf)	119.4	119.4				<u> </u>						continue g opera- the sole
OR OR ELEVATION (FEET)	5'BRG	3 2				ed Procto					Unknown	d on the contractor to server is not observin nt. Test data are not
	F-Line	F-Line		·		85% modified Proctor	··	TS	er		(NESS OF LIFT 1	acement. We have relied ing times when our obsour observer's judgeme
NOI	ng 802,	ng 802,				IATERIAL		VING UN	1) Load	ON UNITS	. THICKI Natural	ervation of fill pl re to the fill du ary to calibrate is.
LOCATION	15'N and 20'E of NW Corner of Buildi	20'N and 20'E of NW Corner of Building 802, F-Line				SPECIFICATION COMPACTION & MATERIAL density.		TYPE AND NUMBER OF EARTH MOVING UNITS	(2) Backhoes, (1) Dozer, (1) Loader	TYPE AND NUMBER OF COMPACTION UNITS Wheel Bolled with Loader	NUMBER OF PASSES AS Reg'd. THICKNESS OF LIFT METHOD OF ADDING MOISTURE Natural	This report presents opinions formed as a result of our observation of fill placement. We have relied on the contractor to continue applying the recommended compactive effort and moisture to the fill furing times when our observer is not observing operations. Tests are made of the fill only as believed necessary to calibrate our observer's judgement. Test data are not the sole basis for opinions on whether the fill meets specifications.


David M. Dix/ram

APPROVED BY

Kevin McNeill FIELD OBSERVER

CAF-1R (6-85)

COPIES

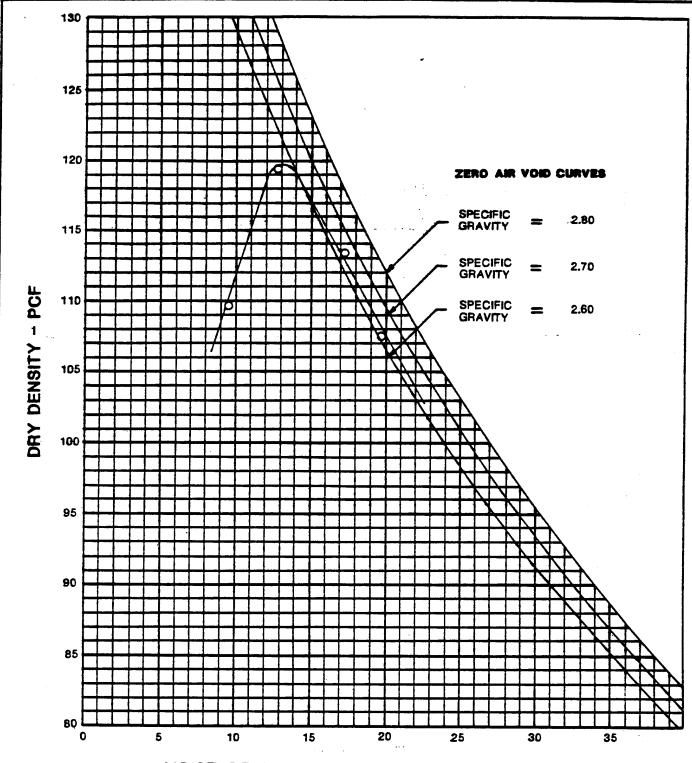

MOISTURE CONTENT - PERCENT OF DRY WEIGHT

LOCATION: Line	A	MOISTURE-DENSITY						
HOLE NO. :	DEPTH :	SAMPLE NO.:		RELATIONSHIPS				
SOIL DESCRIPTION	Silty, Clayey	Chen & Associates						
MAX. DRY DENSITY :	119.4 PCF	OPT. MOIST, CONTENT: 13.1	*	PROCEDURE :ASTM D-1557-7	8 Method A			
LIQUID LIMIT :		PLASTICITY INDEX :		JOB NO.: 1 940F 85	FIG. NO.			
GRAVEL: %	SAND: %	SILT AND CLAY (-200) :	_%	DATE: 10/10/85	2			

Harrison Western Corporation Denver, Colorado 80401 770 Sims Street 10

Attention: Mr. Don Butler



Chen & Associates Consulting Geotechnical Engineers

Date 10/11/85 ō Sheet 1 940 85 ហ Daily Report No. Job No.

Facilities at Basin F, Rocky Mountain Disposal of Hazardous Waste, Subject: Fill Observation and Testing Arsenal, Denver, Colorado.

		T	1	- T	Т			
	SOIL TYPE	Silty, Clayey Sand	Silty, Clayey Sand	Silty, Clayey Sand	Silty, Clayey Sand	Silty, Clayey Sand	Silty, Clayey Sand	Silty, Clayey Sand
	PERCENT COMPACTION	85	98	85	87	88	98	85
LD	MOISTURE CONTENT (%)	12.7	11.5	11.7	10.9	12.5	11.6	11.0
OTHE	DRY Density (pcf)	101.9	102.7	101.8	104.0	105.7	102.8	101.5
ATORY	OPTIMUM MOISTURE CONTENT (%)	13.1	13.1	13.1	13.1	13.1	13.1	13.1
LABORATORY	MAXIMUM DRY DENSITY (pcl)	119.4	119.4	119.4	119.4	119.4	119.4	119.4
DEDIU	OR OR ELEVATION (FEET)	1 BRG	2'BRG	2'BRG	3'BRG	2'BRG	1 BRG	PG
	LOCATION	50'W of Clarifier, A-Line	30'S and 50'W of Clarifier, A-Line	20'N and 75'W of Clarifier, A-Line	75'S of Building 802, C-Line	150'S of Building 802, C-Line	200'S of Building 802, C-Line	250'S of Building 802, C-Line
	· TEST NO.	22	23	24	25	56	27	28

85% modified Proctor THICKNESS OF LIFT. Unknown TYPE AND NUMBER OF EARTH MOVING UNITS (2) Backhoes, (1) Dozer, (1) Loader TYPE AND NUMBER OF COMPACTION UNITS Natural SPECIFICATION COMPACTION & MATERIAL density. As Regid. METHOD OF ADDING MOISTURE Wheel Rolled with Loader NUMBER OF PASSES

☐ FILL TESTED DOES NOT MEET SPECIFICATIONS AS INDICATED BY TEST

FILL TESTED MEETS SPECIFICATIONS.

×

AND SHOULD BE REMOVED OR REWORKED.

PROGRESS REPORT All of the tests taken on this date are

☐ PART TIME OBSERVATION

(X FULL TIME OBSERVATION

(X CONTRACTOR ADVISED

located in the previously removed pipe trench backfill.

This report presents opinions formed as a result of our observation of fill placement. We have relied on the contractor to continue applying the recommended compactive effort and moisture to the fill during times when our observer is not observing operations. Tests are made of the fill only as believed necessary to calibrate our observer's judgement. Test data are not the sole basis for opinions on whether the fill meets specifications.

OPIES	

David M. Dix/ram APPROVED BY

Kevin McNeill

FIELD OBSERVER

Harrison Western Corporation Denver, Colorado 80401 770 Sims Street

2

Attention: Mr. Don Butler



Chen & Associates

Daily Report No. Consulting Geotechnical Engineers

Date 10/14/85 ō Sheet 1 940 85 9 Job No.

Facilities at Basin F, Rocky Mountain Disposal of Hazardous Waste, Subject: Fill Observation and Testing Arsenal, Denver, Colorado.

		DEPTH	LABOR		FIELD	10				
TEST NO.	LOCATION	OR OR ELEVATION (FEET)	MAXIMUM DRY DENSITY (DCD	OPTIMUM MOISTURE CONTENT (%)	DRY DENSITY (pcf)	MOISTURE CONTENT (%)	PERCENT COMPACTION		SOIL TYPE	
29	1200'S of Building 802, 10" Clay Tile Line	25	119.4		114.3	13.9	96	Silty,	Silty, Clayey Sand	and
30	1225'S of Building 802, 10" Clay Tile Line	22	119.4	13.1	113.9	13.5	95	silty,	Silty, Clayey Sand	and
31	1175'S of Building 802, 10" Clay Tile Line	3 E	119.4	13.1	114.7	14.0	96	Silty,	Silty, Clayey Sand	and
32	1100'S of Building 802, 10" Clay Tile Line	RG	119.4	13.1	115.0	13.8	96	Silty,	Silty, Clayey Sand	and

95% modified Proctor SPECIFICATION COMPACTION & MATERIAL density in drainage ditch areas.

THICKNESS OF LIFT TYPE AND NUMBER OF EARTH MOVING UNITS (2) Backhoes, (1) Dozer, (1) Loader TYPE AND NUMBER OF COMPACTION UNITS NUMBER OF PASSES AS Reg'd. Wheel Rolled with Loader

This report presents opinions formed as a result of our observation of till placement. We have relied on the contractor to continue applying the recommended compactive effort and moisture to the fill during times when our observer is not observing operations. Tests are made of the fill only as believed necessary to calibrate our observer's judgement. Test data are not the sole basis for opinions on whether the fill meets specifications.

Natural

METHOD OF ADDING MOISTURE

1	
1	cn
ı	m
ł	=
1	₽.
ı	Õ
ı	\sim
	v

CAF-1R (6-85)

 $oxed{A}$ fill tested meets specifications. \Box fill tested does not meet specifications as indicated by test

AND SHOULD BE REMOVED OR REWORKED.

☐ PART TIME OBSERVATION PHOGHESS REPORT All of the tests taken on this date are the pipe had been removed. The tests were taken in the located in the 10" clay tile line trench backfill after drainage ditch area.

Unknown

Kevin McNeill

David M. Dix/ram APPROVED BY

FIELD OBSERVER

Harrison Western Corporation 80401 Attn: Mr. Don Butler Denver, Colorado 770 Sims Street

٩



Chen & Associates consulting Geotechnical Engineers

Date 11/6/85 Job No. 1 940 85

ŏ Sheet Daily Report No.

Disposal of Hazardous Waste, Facilities at Basin F, Rocky Mountain Arsenal, Commerce Subject: Fill Observation and Testing City, Colorado.

SPECIFICATION COMPACTION & MATERIAL	X) FILL TESTED MEETS SPECIFICATIONS.
85% modified Proctor density	☐ FILL TESTED DOES NOT MEET SPECIFICATIONS AS INDICATED BY TEST
	NO.(S) AND SHOULD BE REMOVED OR REWORKED.
TYPE AND NUMBER OF EARTH MOVING UNITS Unknown	KI CONTRACTOR ADVISED
	☐ FULL TIME OBSERVATION XI PART TIME OBSERVATION
TYPE AND NUMBER OF COMPACTION UNITS Unknown	
	PROGRESS REPORT
NUMBER OF PASSES As Required THICKNESS OF LIFT Unknown	All of the tests taken on this date are located in the
METHOD OF ADDING MOISTURE Unknown	backfill of the removed clarifier and building areas.
This report presents opinions formed as a result of our observation of fill placement. We have relied on the contractor to continue applying the recommended compactive effort and moisture to the fill during times when our observer is not observing operations. Tasts are made of the fill only as believed necessary to calibrate our observer's judgement. Test data are not the sole basis for opinions on whether the fill meets specifications.	

date are located in the er and building areas. David M. Dix/jlg APPROVED BY FIELD OBSERVER Kevin McNeill

CAF-1R (6-85)

COPIES

APPENDIX 2

REPORT ON SERVICE NUMBER 178351H November 19, 1985

To:

Jeff Geiger

Spence-Geiger Associates

Evergreen, Colorado

Analysis:

The following samples were submitted for analysis:

One set membrane filter and Chrom 102 tubes for aldrin and

dieldrin.

Method:

PESTICIDES

The pesticide of interest was extracted with a solvent and

analyzed by gas chromatography with electron capture

detection. The chromatographic peak area for the analyte was compared to a calibration curve obtained from standard

solutions.

Results:

The results are found on Table 1.

Discussion:

The OSHA permissible exposure limit (PEL) for the

following compounds are:

Compound

mg/M3

Aldrin

0.25

Dieldrin

0.25

LT() indicates "less than" with the lower limit of quantification shown in parentheses.

Laboratory data are filed and available upon request.

Submitted by:

David F. Farler

Laboratory Director

DFF/nl

cc: Harrison Western Corp.

SN 17835IH November 19, 1985

TABLE 1

Sample Number: HW 0150(a)		Air Volume: 161. liters
Compound	Total (mg)	Air Concentration
aldrin dieldrin	LT(0.00001) LT(0.00001)	LT(0.00007)mg/cu.M. LT(0.00007)mg/cu.M.
Sample Number: HW 0150(b)		Air Volume: 161. liters
Compound	Total (mg)	Air Concentration
aldrin dieldrin	LT(0.00001) LT(0.00001)	LT(0.00007)mg/cu.M. LT(0.00007)mg/cu.M.

REPORT ON SERVICE NUMBER 178891H November 19, 1985

To:

Jeff Geiger

Spence-Geiger Associates

Evergreen, Colorado

Analysis:

The following samples were submitted for analysis:

One set membrane filter and Chrom 102 tubes for aldrin and

dieldrin.

Method:

PESTICIDES

The pesticide of interest was extracted with a solvent and

analyzed by gas chromatography with electron capture

detection. The chromatographic peak area for the analyte was compared to a calibration curve obtained from standard

solutions.

Results:

The results are found on Table 1.

Discussion:

The OSHA permissible exposure limit (PEL) for the

following compounds are:

Compound mg/M³

Aldrin 0.25

Dieldrin 0.25

LT() indicates "less than" with the lower limit of quantification shown in parentheses.

Laboratory data are filed and available upon request.

Submitted by:

David F. Farler

Laboratory Director

DFF/nl

cc: Harrison Western Corp.

SN 17889IH November 19, 1985

TABLE 1

Sample Number:	HW 0151(a)		Air Volume: 155. liters
Compound		Total (mg)	Air Concentration
aldrin dieldrin		LT(0.00001) LT(0.00001)	LT(0.00007)mg/cu.M. LT(0.00007)mg/cu.M.
Sample Number:	HW 0151(b)		Air Volume: 155. liters
Compound		Total (mg)	Air Concentration
aldrin dieldrin		LT(0.00001) LT(0.00001)	LT(0.00007)mg/cu.M. LT(0.00007)mg/cu.M.

REPORT ON SERVICE NUMBER 179481H November 19, 1985

To:

Jeff Geiger

Spence-Geiger Associates

Evergreen, Colorado

Analysis:

The following samples were submitted for analysis:

Two sets membrane filters and Chrom 102 tubes for aldrin

and dieldrin.

Method:

PESTICIDES

The pesticide of interest was extracted with a solvent and

analyzed by gas chromatography with electron capture

detection. The chromatographic peak area for the analyte was compared to a calibration curve obtained from standard

solutions.

Results:

The results are found on Table 1.

Discussion:

The OSHA permissible exposure limit (PEL) for the

following compounds are:

Compound mg/M³
Aldrin 0.25
Dieldrin 0.25

LT() indicates "less than" with the lower limit of quantification shown in parentheses.

Laboratory data are filed and available upon request.

Submitted by:

David F. Fárler/ Laboratory Director

DFF/nl

cc: Harrison Western Corp.

SN 17948IH November 19, 1985

TABLE 1

Sample Number:	HW 0152(a)		Air Volume: 155. liters
Compound		Total (mg)	Air Concentration
aldrin dieldrin		LT(0.00001) LT(0.00001)	LT(0.00007)mg/cu.M. LT(0.00007)mg/cu.M.
Sample Number:	HW 0152(b)		Air Volume: 155. liters
Compound		Total (mg)	Air Concentration
aldrin dieldrin		LT(0.00001) LT(0.00001)	LT(0.00007)mg/cu.M. LT(0.00007)mg/cu.M.
Sample Number:	HW 0153(a)		Air Volume: 155. liters
Compound		Total (mg)	Air Concentration
aldrin dieldrin		LT(0.00001) LT(0.00001)	LT(0.00007)mg/cu.M. LT(0.00007)mg/cu.M.
Sample Number:	HW 0153(b)		Air Volume: 155. liters
Compound		Total (mg)	Air Concentration
aldrin dieldrin		LT(0.00001) LT(0.00001)	LT(0.00007)mg/cu.M. LT(0.00007)mg/cu.M.

APPENDIX 3



Cenref Laboratory No. See belo	Dat	te Submitted October 21, 1985
Requested By Don J. Butler	Dat	te Completed December 6, 1985
Sample Identification	Analysis	Result
Water Samp.No.2: Casing water	Reactivity	less than 1.0 mg/kg
from frac tank #1	рН	9.3
(C85HW-187)	Phenols	0.43 mg/1
·		
Water Samp.No.4: Clarifier	Reactivity	20 mg/kg
water from sumps	рН	6.9
(C85HW-188)	Phenols	0.03 mg/l
Water Samp.No.9: Washdown	Reactivity	less than 1.0 mg/kg
water from carbon cell	pН	8.0
Flow thru volume = 1463 gal.	Phenols	0.02 mg/l
(C85HW-189)		
Water Samp.No.10: Clarifier	Reactivity	6.5 mg/kg
water after settling tanks and	pН	6.4
carbon cell		
Flow thru volume - 3200 gal.		
(C85HW-190)		
L. C.		I

•	Purchase	Order	#62246-07

HWC(D)DB CRC-2 R.C. States (SAR)

General Manager Title

Invoice: Harrison Western, 770 Simms Street, Denver, CO 80401



Cenref Lab No. C85MS-250	Date Submitted Oct. 28 & Nov. 6, 1985
Requested ByDon Butler	Date Completed <u>December 10, 1985</u>
Sample Description: Casing Water f	rom Frac Tank #1
•	
Analysis	Results
Dioxin	Not Seen
Comments: Dioxin screen per EPA Me	thod 625
cc: HWC(D)DB	Title
CRC-2	Q. C. III (TAB General Manager

Executive Offices: P.O. Box 1197, Kansas City, Missouri 64141

Mid-Continent Area: R.R. 2, Box 119, Liberal, Kansas 67901 • (316) 624-4292

Invoice: Harrison Western Corp.

Rocky Mountain Area: P.O. Box 68, Brighton, Colorado 80601 • (303) 659-0497



Cenref Lab No. <u>C85MS-251</u>	Date Submitted 10/28/85 & 11/6/85
Requested By Don Butler	Date Completed December 10, 1985
Sample Description: Clarifier Water from S	Sumps P.O. # 62246-074
Analysis	Results
Dioxin	Not seen
DTMP	350 дуд/1
DMMP	2 µg/1
Comments:	
	R.C. States (743) General Manager Title
cc: HWC-Denver CRC-2	Title

Executive Offices: P.O. Box 1197, Kansas City, Missouri 64141

Invoice: Harrison Western



EPA Method 625

(Page 1 of 2)

Cenref Lab No. <u>C85MS-251</u>	Date Sampled	
Sampled by	Date Received	10/28/85 & 11/6/85
Requested by Don Butler	Date Completed	December 6, 1985
Sample Description: Clarifier H ₂ O from	n Sumps P.O. #62246	-075

SEMI-VOLATILE ORGANICS: (BASE/NEUTRAL ACID EXTRACT)	CAS No.:	RESULT:	AMDL: (µg/1)²	SDL: (µ1g/1)³
Phenol	108-95-2	21	10	14
bis(-2-Chloroethyl)Ether	111-44-4	BDL	5	7
2-Chlorophenol	95-57-8	BDL	10	14
1,3-Dichlorobenzene	541-73-1	BDL	5	7
1,4-Dichlorobenzene	106-46-7	BDL	5	7
1,2-Dichlorobenzene	95-50-1	BDL	5	77
bis(2-chloroisopropyl)Ether	39638-32-9	BDL	5	7
N-Nitroso-Di-n-Propylamine	621-64-7	BDL	5	77
Hexachloroethane	67-72-1	BDL	10	14
Nitrobenzene	98-95-3	BDL	5	77
Isophorone	78-59-1	BDL	1	11
2-Nitrophenol	88-75-5	BDL	10	14
2,4-Dimethylphenol	105-67-9	BDL	10	14
bis(-2-Chloroethoxy)Methane	111-91-1	BDL	5	7
2,4-Dichlorophenol	120-83-2	BDL	5	7
1,2,4-Trichlorobenzene	120-82-1	EDL	1	11
Naphthalene	91-20-3	EDL	11	11
Hexachlorobutadiene	87-68-3	BDL	1	1
4-Chloro-3-Methylphenol	59-50-7	BDL	1	11
2,4,6-Trichlorophenol	88-06-2	BDL	10	14
2-Chloronaphthalene	91-58-7	BDL	5	7
Dimethyl Phthalate	131-11-3	BDL	1	1
Acenaphthylene	208-96-8	BDL	5	7
Acenaphthene	83-32-9	DDL	5	7
2,4-Dinitrophenol	51-28-5	BDL	50	70
4-Nitrophenol	100-02-7	BDL	50	70
2 4-Dinitrotoluene	121-14-2	BDL	10	14
2,6-Dinitrotoluene	606-20-2	BDL	5	7
Diethylphthalate	84-66-2	BDL	5	7
4-Chlorophenyl-phenylether	7005-72-3	BDL	5	7
Fluorene	86-73-7	BDL	5	7
4,6-Dinitro-2-Methylphenol	534-52-1	BDL	5	77
4-Bromophenyl-phenylether	101-55-3	BDL	10	14
Hexachlorobenzene	118-74-1	BDL	5	7
Pentachlorophenol	87-86-5	BDL	25	35

Executive Offices: P.O. Box 1197, Kansas City, Missouri 64141



EPA Method 625

(Page 2 of 2)

Cenref Lab No. C85MS-251

SEMI-VOLATILE ORGANICS: (BASE/NEUTRAL ACID EXTRACT)	CAS No.:	RESULT: (ug/1) 1	AMDL (ug/1) ²	SDL: (ug/1) ³
Phenanthrene	85-01-8	BDL	10	14
Anthracene	120-12-7	BDL	5	7
Di-n-Butylphthalate	84-74-2	BDL	10	14
Fluoranthene	206-44-0	BDL	10	14
Pyrene	129-00-0	BDL	10	14
Butylbenzylphthalate	85-68-7	BDL	5	7
3,3'-Dichlorobenzidine	91-94-1	BDL	10	14
Benzo(a)Anthracene	56-55-3	BDL	1	1
bis(2-Ethylhexyl)Phthalate	117-81-7	BDL	5	7
Chrysene	218-01-9	BDL	10	14
Di-n-Octyl Phthalate	117-84-0	BDL	10	14
Benzo(b)Fluoranthene	205-99-2	BDL	10	14
Benzo(k)Fluoranthene	207-08-9	EDL	10	14
Benzo(a)Pyrene	50-32-8	BDL.	5	77
Indeno(1,2,3-cd)Pyrene	193-39-5	BDL	5	7
Dibenz(a h)Anthracene	53-70-3	BDI.	5	7
Benzo(g.h.i)Perylene	191-24-2	BDL	10	14

¹BDL = "Below Detection Limit" (SDL)

²Approximate Method Detection Limit

³Sample Detection Limit (if different than AMDL)

Comme	nts: <u>S</u> a	mple also	contained	substantial	amounts	of organic	acid	_
								_
				A 0	Sta	(TAB)	General Manager Title	
cc:	HWC-Denve	er		<u>U., Z.,</u>	<u>equer</u>	()+D/	General Manager Title	-

cc: HWC-Denver

CRC-2

INVOICE: Harrison & Western

Executive Offices: P.O. Box 1197, Kansas City, Missouri 64141



Cenref Lab No. C85MS 252	Date Submitted 10/28/85 & 11/6/85
Requested By Don Butler	Date Completed December 10, 1985
Sample Description: Washdown Water from	Carbon Cell P.O. # 62246-074
Analysis	Results
Dioxin	Not Seen
	· .
Comments: Dioxin screen per EPA Metho	od. 625
cc: HWC-Denver CRC-2	R.C. Ditter (708 General Manager Title

Executive Offices: P.O. Box 1197, Kansas City, Missouri 64141

Mid-Continent Area: R.R. 2, Roy 119, Liberal, Kansas 67901 • (3)

Invoice: Harrison Western



Cenref Lab No.	C85MS-253	Date Submitted _	Oct. 28 & Nov. 6, 1985
Requested By	Don Butler	Date Completed _	December 10, 1985
Sample Descript: P.O. #62246-074	ion: Clarifier Water after	settling tanks and car	bon cell
	Analysis		Results
Dioxin			Not Seen
Comments: Diox	in screen per EPA Method 625	5	
			Title
cc: HWC(D)DB CRC-2		R. C. States CIAB) General Manager

Executive Offices: P.O. Box 1197, Kansas City, Missouri 64141

Mid-Continent Area: R.R. 2, Box 119, Liberal, Kansas 67901 • (316) 624-4292

Invoice: Harrison Western Corp.

Rocky Mountain Area: P.O. Box 68, Brighton, Colorado 80601 • (303) 659-0497



Cenref Lab No.	C85MS-254	Date	Submitted	October 28 & November 6,	1985
Requested By	Don Butler	Date	Completed	December 11, 1985	
Sample Description:_	Triple Rinse Water				
	P. O. #62246-074				
	Analysis			Results	
Dioxin				Not Seen	
	•				
			<u> </u>		
Comments: Dioxin se	creen per EPA Method 62	.5			
					•
					•
cc: HWC(D)DB				Title	
CRC-2		Q. Q.	stites co	46) General Manager	

Executive Offices: P.O. Box 1197, Kansas City, Missouri 64141

Invoice: Harrison Western Corp.



Cenref Lab No. <u>C85MS-255</u>	Date Submitted 10/28/85 & 11/6/85
Requested By Don Butler	Date Completed December 11, 1985
Sample Description: <u>Earth Blended Soil</u>	Sample P.O. # 62246-074
Analysis	Results
Dioxin	YES
DIMP	Less than 10 µg/kg
DMMP	Less than 10 µg/kg
	-
Comments: Dioxin Screen per FPA Metho	od 625 further tests by Dioxin Lab
	of Dioxin.
cc: HWC-Denver	R.C. Ditter (TAG) General Manager Title

Invoice: Harrison Western



EPA Method 625

(Page 1 of 2)

Cenref Lab No. <u>C85MS-255</u>	Date Sampled
Sampled by	Date Received 10/28/85 & 11/6/85
Requested by <u>Don Butler</u>	Date Completed <u>December 10, 1985</u>
Comple Decominations	P O. # 62246-074

SEMI-VOLATILE ORGANICS: (BASE/NEUTRAL ACID EXTRACT)	CAS No.:	RESULT: (ug/kg) ¹	AMDL: (µg/1)²	SDL: (ug/kg)³
Phenol	108-95-2	BDL	10	333
bis(-2-Chloroethyl)Ether	111-44-4	BDL	5	166
2-Chlorophenol	95-57-8	BDL	10	333
1,3-Dichlorobenzene	541-73-1	BDL	5	166
1,4-Dichlorobenzene	106-46-7	BDL	<u>5</u>	166
1,2-Dichlorobenzene	95-50-1	BDL	5	166
bis(2-chloroisopropyl)Ether	39638-32-9	BDL	5	166
N-Nitroso-Di-n-Propylamine	621-64-7	BDL	5	166
Hexachloroethane	67-72-1	BDL	10	333
Nitrobenzene	98-95-3	BDL	5	166
Isophorone	78-59-1	BDL	1	33
2-Nitrophenol	88-75-5	BDL	10	333
2,4-Dimethylphenol	105-67-9	BDL	10	333
bis(-2-Chloroethoxy)Methane	111-91-1	BDL	5	166
2,4-Dichlorophenol	120-83-2	BDL	5	166
1,2,4-Trichlorobenzene	120-82-1	BDL	1	33
Naphthalene	91-20-3	BDL	1	33
Hexachlorobutadiene	87-68-3	BDI.	1	33
4-Chloro-3-Methylphenol	59-50-7	BDL	1	33
2,4,6-Trichlorophenol	88-06-2	BDI.	10	333
2-Chloronaphthalene	91-58-7	BDL	5	166
Dimethyl Phthalate	131-11-3	BDL	1	33
Acenaphthylene	208-96-8	BDL	5	166
Acenaphthene	83-32-9	BDL	5	166
2,4-Dinitrophenol	51-28-5	BDL	50	1660
4-Nitrophenol	100-02-7	BDL	50	1660
2 4-Dinitrotoluene	121-14-2	BDL	10	333
2,6-Dinitrotoluene	606-20-2	BDL	5	166
Diethylphthalate	84-66-2	BDL	5	166
4-Chlorophenyl-phenylether	7005-72-3	_BDL	5	166
Fluorene	86-73-7	BDL	5	166
4,6-Dinitro-2-Methylphenol	534-52-1	BDL	5	166
4-Bromophenyl-phenylether	101-55-3	BDL	10	_ 333
Hexachlorobenzene	118-74-1	BDL	5	166
Pentachlorophenol	87-86-5	BDL	25	832

Executive Offices: P.O. Box 1197, Kansas City, Missouri 64141



EPA Method 625

(Page 2 of 2)

Cenref Lab No. C85MS-255

SEMI-VOLATILE ORGANICS:	CAS No.:	RESULT:	AMDL	SDL:
(BASE/NEUTRAL ACID EXTRACT)		(µg/1) 1	(µg/1) 2	(ug/1) 3
Phenanthrene	85-01-8	BDL	10	333
Anthracene	120-12-7	BDL	5	166
Di-n-Butylphthalate	84-74-2	BDL	10	333
Fluoranthene	206-44-0	BDL	10	333
Pyrene	129-00-0	BDL	10	333
Butylbenzylphthalate	85-68-7	BDL	5.	166
3,3'-Dichlorobenzidine	91-94-1	BDL	10	333
Benzo(a)Anthracene	56-55-3	BDL	1	33
bis(2-Ethylhexyl)Phthalate	117-81-7	BDL	5	166
Chrysene	218-01-9	BDL	10	333
Di-n-Octyl Phthalate	117-84-0	BDL	10	333
Benzo(b)Fluoranthene	205-99-2	BDL	10	333
Benzo(k)Fluoranthene	207-08-9	BDL	10	333
Benzo(a)Pyrene	50-32-8	BDL	5	166
Indeno(1,2,3-cd)Pyrene	193-39-5	BDL	5	166
Dibenz(a h)Anthracene	53-70-3	BDL	5	166
Benzo(g.h.i)Perylene	191-24-2	BDL	10	333

¹BDL = "Below Detection Limit" (SDL)

²Approximate Method Detection Limit

³Sample Detection Limit (if different than AMDL)

Comm	ents: Result	s on weight a	as received.	
cc:	HWC-Denver		a. C. Stiter (JAS)) <u>General Manager</u> Title

Invoice: Harrison Western

CRC-2



Cenref Lab No. C85MS-256	Date Submitted Oct. 28 & Nov. 6, 1985
Requested By Don Butler	Date Completed <u>December 10, 1985</u>
Sample Description: Wood from Large Raf	t Pile
P.O. #62246-074	
Analysis	Results
Dioxin	Not seen
Comments: Dioxin screen per EPA Method	625
	Title
cc: HWC(D)DB CRC-2	Q. C. Stites (JAG General Manager

Invoice: Harrison Western Corp.



Cenref Lab No. <u>C85MS-257</u>	Date Submitted Oct. 28 & Nov. 6, 1985
Requested By Don Butler	Date Completed December 10, 1985
Sample Description: Concrete	
P.O. #62246-074	
Analysis	Results
Dioxin	Not seen
·	
Comments: Dioxin screen per EPA Method 625	
	0 0 111
cc: HWC(D)DB CRC-2	C. States (TAS) General Manager Title

Executive Offices: P.O. Box 1197, Kansas City, Missouri 64141

Invoice: Harrison Western Corp.



Century Refining Company

CENREF LABORATORY REPORT

Cenref Lab No	C85P-1572	Date Submitted_	10/28/85 & 11/6/85
Requested By	Don Butler	Date Completed_	December 6, 1985
Sample Description:	Casing Water from	Frac Tank #1	P.O. # 62246-074

Analysis		Results	
Alpha-BHC	Less than	0.05	μg/l
Beta-BHC	Less than	0.05	μg/1
Delta-BHC	Less than	0.05	ր8/1
Gamma-BHC (Lindane)	Less than	0.05	ия/1
Heptachlor	Less than	0.05	μg/l
Aldrin	Less than	0.05	μg/1
Heptachlor Epoxide	Less than	0.05	μg/1
Endosulfan I	Less than	0.05	μg/l
Dieldrin	Less than	0.10	μg/1
4_4-DDE	Less than	0.10	μg/l
Endrin	Less than	0.10	μg/1
Endosulfan II	Less than	0.10	μg/1
4 4-DDD	Less than	0.10	µg/1
Endosulfan Sulfate	Less than	0.10	ug/1
4,4-DDT	· Less than	0.10	μg/1
Methexychlor	Less than	0.5	ug/1
Endrin Ketone	Less than	0.10	μg/1
Chlordane	Less than	0.5	µg/1
Toxaphene	Less than	1.0	μg/l
Aroclor-1016	Less than	0 . 5	μg/1
Aroclor-1221	Less than	0.5	µg/1
Aroclor-1232	Less than	0.5	ug/1
Aroclor-1242	Less than	0.5	ug/l
Aroclor-1248	Less than	0.5	μg/l
Aroclor-1254	Less than	1.0	ug/l
Aroclor-1260	Less than	1.0	μg/1

cc:

HWC-Denver

CRC-2

Q. C. Ditto (546) General Manager
Title

INVOICE: Harrison Western



Cenref Lab No. C85P-1572	Date Submitted 10/28/85 & 11/6/85
Requested By Don Butler	Date Completed December 11, 1985
Sample Description: Casing Water from Frac	Tank #1 P.O. # 62246-074
Analysis	Results
2,4 - D	Less than 10 ug/kg
2,4 - DB	Less than 10 µg/kg
2,4,5 - T	Less than l µg/kg
2,4,5 - TP	Less than 1 µg/kg
Dichlorprop	Less than 10 ug/kg
MCPA	Less than 2000 µg/kg
MCPP	Less than 2000 µg/kg
Comments: This sample bottle contained s	ludge with little water present.
Sample was weighed and data re	
cc: HWC-Denver CRC-2	R.C. Ditter (TAB) General Manager Title

Invoice: Harrison Western



Cenref Lab No. C85P-1573	Date Submitted Oct. 28 & Nov. 6, 1985
Requested By Don Butler	Date Completed December 6, 1985
Sample Description: Clarifier Water fr	rom Sumps
P.O. #62246-074	
	D 1
Analysis	Results
Alpha-BHC	less than 0.05 ag/1
Beta-BHC	less than 0.05 Aug/l
Delta-BHC	less than 0.05 Ag/l
Gamma-BHC (Lindane)	less than 0.05 mg/1
Heptachlor	less than 0.05 Aug/l
Aldrin	less than 0.05 µg/l
Heptachlor Epoxide	less than 0.05 µg/l
Endosulfan I	less than 0.05 Aug/l
Dieldrin	less than 0.10 Aug/l
4,4-DDE	less than 0.10 Aug/l
Endrin	less than 0.10 Aug/l
Endosulfan II	less than 0.10 ag/1
4,4-DDD	less than 0.10 ag/1
Endosulfan Sulfate	less than 0.10 aug/l
4,4 ² DDT	less than 0.10 Aug/1
Methoxychlor	less than 0.5 Aug/l
Endrin Ketone	less than 0.10 ag/1
Chlordane	less than 0.5 aug/l
Toxaphene	less than 1.0 µg/1
Aroclor-1016	less than 0.5 ug/l
Aroclor-1221	less than 0.5 μ g/l
Aroclor-1232	less than 0.5 $\log/1$
Aroclor-1242	less than 0.5 µg/l
Aroclor-1248	less than 0.5 μ g/l
Aroclor-1254	less than 1.0 Aug/1
Aroclor-1260	less than 1.0 ug/l

CRC-2

O. C. Sauton (TAG) General Manager Title

Invoice: Harrison Western Corp.



Cenref Lab No. C85P-1573	Date Submitted Oct. 28 & Nov. 6, 1985
Requested ByDon Butler	Date Completed <u>December 11, 1985</u>
Sample Description: Clarifier Water fr	om Sumps
Analysis	Results
2,4 - D	less than 1 µg/1
2,4 - DB	1
2,4,5 - T	
2,4,5 - TP	1
Dichlorprop	less than 1 ug/1
MCPA	less than 200 /ug/l
MCPP	less than 200 /ug/l
,	
Comments: P.O. #62246-074	
	Title
HWC(D)DB CRC-2	R. C. Stiter (JAB) General Manager

Invoice: Harrison Western Crop.



Cenref Lab No. <u>C85P-1574</u>	Date Submitted 10/28/85 & 11/6/8	5
Requested ByDon Butler	Date Completed <u>December 6 1985</u>	
ample Description: Washdown Water	from Carbon cell P.O. # 62246-074	
ample beschiption.		
Analysis	Results	
Alpha-BHC	Less than 0.05 µg/	1
Beta-BHC	Less than 0.05 µg/	1
Delta-BHC	Less than 0.05 ug/	<u>'1</u>
Gamma-BHC (Lindane)	Less than 0.05 ug/	<u>′1</u>
Heptachlor	Less than 0.05 µg/	<u>'1</u>
Aldrin	Less than 0.05 µg	/1
Heptachlor Epoxide	Less than 0.05 µg	/1
Endosulfan I	Less than 0.05 µg	/1
Dieldrin	Less than 0.10 Mg	/1
4 4-DDE	Less than 0.10 µg	/1
Endrin	Less than 0.10 µg	/1
Endosulfan II	Less than 0.10 µg	/1
4 4-DDD	Less than 0.10 ug	/1
Endosulfan Sulfate	Less than 0.10 ug	/1
4 4-DDT	Less than 0.10 µg	/1
Methoxychlor	Less than 0.5 µc	/1
Endrin Ketone	Less than 0.10 µg	/1
Chlordane	Less than 0.5 µg	/1
Toxaphene	Less than 1.0 µg	/1
Aroclor-1016		/1
Aroclor-1221	Less than 0.5 us	/1
Aroclor-1222	Less than 0.5 us	/1
Aroclor-1242		/1
Aroclor-1248	Less than 0.5 µs	/1
Aroclor-1254		;/1
Arctor-1234		2/1

cc:

HWC-Denver

CRC-2

R. P. Dittes (Total General Manager Title

INVOICE, Harrison Western



Less tha Less tha Less tha Less tha Less tha	Resulan 1 an 1 an 0. an 0. an 1 an 200	
Less tha Less tha Less tha Less tha Less tha Less tha	Resulan 1 an 1 an 0. an 0. an 1 an 200	μg/l μg/l l μg/l l μg/l μg/l
Less tha Less tha Less tha Less tha Less tha	an 1 an 0. an 0. an 1 an 200	μg/l μg/l l μg/l l μg/l μg/l
Less tha Less tha Less tha Less tha Less tha	an 1 an 0. an 0. an 1 an 200	μg/l μg/l l μg/l l μg/l μg/l
Less tha Less tha Less tha Less tha Less tha	an 1 an 0. an 1 an 1 an 200	ug/1 l ug/1 l ug/1 ug/1 ug/1
Less tha Less tha Less tha Less tha	an 0. an 1 an 200	1 µg/1 1 µg/1 µg/1
Less tha Less tha Less tha	an 0. an 1 an 200	l µg/l µg/l
Less tha	an 1 an 200	ug/1
Less tha	an 200	
		րե/1
Less tha	an 200	
		րե/1

Invoice: Harrison Western



Cenref Lab No. <u>C85P-1575</u>		Date Submitted	10/28/85 & 11/6/85
Requested By <u>Don Butler</u>		Date Completed	December 6, 1985
Sample Description:	Clarifier Water	after Settling Tanks	and Carbon Cell
			P.O. # 62246-074

Analysis		Results	
Alpha-BHC	Less than	0.05	μg/1
Beta-BHC	Less than	0.05	дg/1
Delta-BHC	Less than	0.05	µg/1
Gamma-BHC (Lindane)	Less than	0.05	μg/1
Heptachlor	Less than	0.05	де/1
Aldrin	Less than	0.05	дg/1
Heptachlor Epoxide	Less than	0.05	μg/1.
Endosulfan I	Less than	0.05	μg/1
Dieldrin	Less than	0.10	μg/l
4 4-DDE	. Less than	0.10	μg/1
Endrin	Less than	0.10	µg/l
Endosulfan II	Less than	0.10	μg/l
4 4-DDD	Less than	0.10	μg/l
Endosulfan Sulfate	Less than	0.10	ug/l
4 4-DDT	Less than	0.10	μg/l
Methoxychlor	Less than	0.5	ng/l
Endrin Ketone	Less than	0.10	μg/l
Chlordane	Less than	0.5	дg/1
Toxaphene	Less than	1.0	μg/1.
Aroclor-1016	Less than	0.5	µg/l
Aroclor-1221	Less than	0.5	µg/1
Aroclor-1232	Less than	0.5	μg/1
Aroclor-1242	Less than	0.5	μg/l
Aroclor-1248	Less than	0.5	ug/l
Aroclor-1254	Less than	1.0	μg/l
Aroclor-1260	Less than	1.0	ug/l

cc: HWC+Denver CRC~2

INVOICE: Harrison Western

Q.C. States (TAG) General Manager



Cenref Lab No. <u>C85P-1575</u>	Date Submitted 10/28/85 & 11/6/85
Requested By Don Butler	Date Completed December 11, 1985
Sample Description: Clarifier	Water after Settling Tanks and Carbon Cell
· · ·	P.O. # 62246-074
Avelveis	Results
Analysis	
2.4 - D	1
2,4 - DB	
2,4,5 - T 2,4,5 - TP	
Dichlorprop	
MCPA	Less than 200 µg/1
МСРР	Less than 200 µg/1
	·
Comments:	
cc: HWC-Denver CRC-2	Q.C. Dtto (546) General Manager Title

Invoice: Harrison Western



Cenref Lab No. <u>C85P-1576</u>	Date Submitted Oct. 28 & Nov. 6, 1985
Requested ByDon Butler	Date Completed December 6, 1985
Sample Description: Triple Rinse Water	
P. O. #62246-074	
Analysis	Results
Alpha-BHC	less than 0.05 يور/1
· Beta-BHC	less than 0.05 ag/1
Delta-BHC	less than 0.05 ag/1
Gamma-BHC (Lindane)	less than 0.05 µg/l
Heptachlor	less than 0.05 µg/l
Aldrin	less than 0.05 µg/1
Heptachlor Epoxide	less than 0.05 aug/l
Endosulfan I	less than 0.05 ag/1
Dieldrin	0.16 ug/1
4,4-DDE	less than 0.10 ug/1
Endrin	less than 0.10 mg/1
Endosulfan II	less than 0.10 mg/1
4,4-DDD	less than 0.10 ug/l
Endosulfan Sulfate	less than 0.10 ag/l
4 4-DDT	less than 0.10 Aug/1
Methoxychlor	less than 0.5 $\mu g/1$
Endrin Ketone	less than 0.10 Aug/1
Chlordane	less than 0.5 Aug/l
Toxaphene	less than 1.0 Aug/1
Aroclor-1016	less than 0.5 aug/1
Aroclor-1221	less than 0.5 Aug/1
Aroclor-1232	less than 0.5 ${\rm Aug}/1$
Aroclor-1242	less than 0.5 µg/1
Aroclor-1248	less than 0.5 Aug/l
Aroclor-1254	less than 1.0 µg/1
Aroclor-1260	less than 1.0 µg/l

ce: HWC(D)DB CRC-2

General Manager
Title

Invoice: Harrison Western Corp.



Cenref Lab No.	C85P-1576	Date	Submitted	Oct. 28 & Nov. 6, 1985
Requested By	Don Butler	Date	Completed	December 11, 1985
Sample Descript	ion: Triple Rinse Water			
	Analysis			Results
2,4 - D			less th	an l ug/l
			less th	an 1 מען/1
2,4,5 - T				an 0.1 µg/1
		1		an 0.1 /ug/1
<u>DichlorProp</u>			less th	an 1 μg/1
MCPA			less th	an 200 /ug/1
MCPP			less th	an 200 🗓 🗓 🗓 🗓 🗓 🗓 an 200
			-	
		-		
Comments: P.O.	#62246-074			
•				
cc: HWC(D)DB CRC-2		0 6	.	Title
		(K. C.	Otites or	Ab) General Manager

Invoice: Harrison Western Corp.



Cenref Lab No	C85P-1577	Date Submitted	10/28/35 & 11/6/85
Requested By	Don Butler	Date Completed_	December 6, 1985
Sample Description	Earth - Blended	Soil Samples F	? O. # 62246-074

Analysis		Results	
Alpha-BHC	Less than	88	μg/kg
Beta-BHC	Less than	88	μg/kg
Delta-BHC	Less than	8	μg/kg
Gamme-BHC (Lindane)	Less than	88	μg/kg
Heptachlor	Less than	8	μg/kg
Aldrin		230	µg/kg
Heptachlor Epoxide	Less than	8	µg/kg
Endosulfan I	Less than	8	μg/kg
Dieldrin		310	μg/kg
4 4-DDE	Less than	16	µg/kg
Endrin		230	μg/kg
Endosulfan II	Less than	16	µg/kg
4, 4-DDD	Less than	1.6	μg/kg
Endosulfan Sulfate	Less than	16	µg/kg
4_4-DDT	Less than	16	μg/kg
Methexychler	Less than	80	ng/kg
Endrin Ketone	Less than	16	μg/kg
Chlordane	Less than	80	με/kg
Toxaphene	Less than	160	μg/kg
Aroclor-1016	Less than	80	μg/kg
Aroclor-1221	Less than	80	µg/kg
Aroclor-1232	Less than	80	µg/kg
Aroclor-1242	Less than	80	μg/ kg
Aroclor-1248	Less than	80	ug/kg
Aroclor-1254	Less than	160	μg/ kg
Aroclor-1260	Less than	160	μg/kg

HWC-Denver cc: CRC-2

R. C. Stites (TAB) General Manager Title

INVOICE Harrison Western



Cenref Lab No. C85P-1577	Date Submitted Oct. 28 & Nov. 6, 1985
Requested By Don Butler	Date Completed December 11, 1985
Sample Description: Earth -	Blended Soil Samples
Analysis	Results
2,4 - D	less than 10 µg/kg
2,4 - DB	less than 10 ug/kg
2,4,5 - T	less than l µg/kg
2.4.5 - TP	
Dichlorprop	less than 10 ag/kg
MCPA	2000 /1
MCPP	less than 2000 µg/kg
Comments: P.O. #62246-074	
cc: HWC(D)DB	Q.C. State (TAB) General Manager Title

Invoice: Harrison Western Corp.



CENREF LABORATORY REPORT

Cenref Lab No	C85P-1578	Date Submitted_	10/28/85 & 11/6/85
Requested By	Don Butler	Date Completed_	December 6, 1985
Sample Description	on: Wood From Large Raft	Pile	P.O # 62246-074

Analysis	Results		
Alpha-BHC	Less than	8	ug/kg
Beta-BHC	Less than	8	дg/kg
Delta-BNC	Less than	8	µg/kg
Gamma-BHC (Lindane)	Less than	. 8	ug/kg
Heptachlor	Less than	8	µg/kg
Aldrin		25	ug/kg
Heptachlor Epoxide	Less than	88	ug/kg
Endosulfan I	Less than	88	μg/kg
Dieldrin		32	μg/kg
4 4-DDE	Less than	16	μg/kg
Endrin	Less than	16	μg/kg
Endosulfan II	Less than	16	µg/kg
4 4-DDD	Less than	16	μg/kg
Endosulfan Sulfate	Less than	16	µg/kg
4 4-DDT	Less than	16	ug/kg
Methoxychler	Less than	80	μg/kg
Endrin Ketone	Less than	16	μg/kg
Chlordane	Less than	80	μg/kg
Toxaphene	Less than	160	ug/kg
Aroclor-1016	Less than	80	µg/kg
Aroclor-1221	Less than	80	µg/kg
Aroclor-1232	Less than	80	µg/kg
Aroclor-1242	Less than	80	ug/kg
Aroclor-1248	Less than	80	μg/ kg
Arcclor-1254	Less than	160	μg/ kg
Aroclor-1260	Less than	160	μg/ kg
ALOCTOL-1500	Dess Litali		

cc:

HWC-Denver

CRC -2

R. P. Stutes (JAB) General Manager Title

INVOICE Harrison Western

Executive Offices: P.O. Box 1197, Kansas City, Missouri 64141 Mid-Continent Area: R.A. 2, Box 119, Liberal, Kansas 67901 • (316) 624-4292 Rocky Mountain Area: P.O. Box 68, Brighton, Colorado 80601 • (303) 659-0497



CENREF LABORATORY REPORT

Cenref Lab No. C85P-1578	Date Submitted Oct. 28 & Nov. 6, 1985
Requested By Don Butler	Date Completed <u>December 11, 1985</u>
Sample Description: Wood from Large Raft H	Pile
Analysis	Results
2,4 - D	less than 10 µg/kg
2,4 - DB	less than 10 µg/kg
2,4,5 - T	less than l µg/kg
2,4,5 - TP	less than 1 µg/kg
Dichlorprop	less than 10 µg/kg
МСРА	less than 2000 µg/kg
МСРР	less than 2000 Ag/kg
	·
Comments: P.O. #62246-074	
	Title
cc: HWC(D)DB CRC-2	P. C. Dtto (TAB) General Manager

Invoice: Harrison Western Corp.



Century Refining Company

CENREF LABORATORY REPORT

Cenref Lab No	C85P 1579	Date Submitted 19/28/85 & 11/6/85
Requested By	Don Butler	Date Completed <u>December 6, 1985</u>
Sample Descripti	OD: Gamana	P.O. # 62246-074

Analysis	Results		
Alpha-BHC	Less than	8	ug/kg
Beta-B‼C	Less than	8	ug/kg
Delta-BHC	Less than	8	ug/re
Gamma-BHC (Lindane)	Less than	8	ug/kg
Heptachlor	Less than	8	ug/kg
Aldrin		75	ug/kg
Heptachlor Epoxide	Less than	8	ug/kg
Endosulfan I	Less than	88	ug/kg
Dieldrin		. 59	ug/kg
4 4-DDE	· Less than	16	ug/kg
Endrin		46	ug/kg
Endosulfan II	Less than	16	ug/kg
4 4-DDD	Less than	16	ug/kg
Endosulfan Sulfate	Less than	16	ug/kg
4 4-DDT	Less than	16	ug/kg
Methoxychlor	Less than	80	ug/kg
Endrin Ketone	Less than	16	ug/kg
Chlordane	Less than	80	ug/ke
Toxaphene	Less than	160	ug/kg
Aroclor-1016	Less than	80	ug/kg
Aroclor-1221	Less than	80	ug/ _{kg}
Aroclor-1232	Less than	80	ug/kg
Aroclor-1242	Less than	80	ug/kg
Aroclor-1248	Less than	80	ug/kg
Aroclor-1254	Less than	160	ug/kg
Aroclor-1260	Less than	160	ug/kg

c:

HWC-Denver CRC-2

R. C. Dute (JAB) General Manager

INVOICE Harrison Western

Executive Offices: P.O. Box 1197, Kansas City, Missouri 64141 Mid-Continent Area: R.R. 2, Box 119, Liberal, Kansas 67901 • (316) 624-4292 Rocky Mountain Area: P.O. Box 68, Brighton, Colorado 80601 • (303) 659-0497



CENREF LABORATORY REPORT

Cenref Lab No. <u>C85P-1579</u>	Date Submitted Oct. 28 & Nov. 6, 1985
Requested By Don Butler	Date Completed December 11, 1985
Sample Description: Concrete	
Analysis	Results
2,4 - D	less than 10 µg/kg
2,4 - DB	
2,4,5 - T	less than l µg/kg
2,4,5 - TP	
Dichlorprop	less than 10 µg/kg
МСРА	less than 2000 µg/kg
МСРР	less than 2000 ug/kg
Comments: P.O. #62246-074	
	0 0
CRC-2	Q. C. Styles (786) General Manager Title

Invoice: Harrison Western Corp.

I certify that I have examined	
cular reference to paragraph 4 of the project contract qualified to participate in the Rocky Mountain Arsena Disposal Facilities Closure project. If the employee not capable of reproduction.	uith parti- ct and declare him/her Ll, Hazardous Waste is a female, she is
date signed:	
Oate:	
Signed	M.O. \$88101011
Closure of Hazardous Waste Disposal Facility at Basin F Post-Employment Medical Evaluation Rocky Mountain Arsenal Commerce City, Colorado Medical Certificate	
date following months of and	on this
Hazardous Waste Disposal Facilities Closure project, and is free of symptomatology and sizes of income.	y Mountain Arsenal,
is free of symptometology and sizes of i	certify that he/she
is free of symptomatology and signs of impairment of heal	th related to such
Data: 11) 20/85	
Signes Mount w	M.O. down & a
	_ M.D. 经营务会)

North the Anna The Control of the Co	
I certify that I have examined	with part
cular reference to paragraph 4 of the project contract	ord part
qualified to participate in the Books Mountain	and declare him/her
qualified to participate in the Rocky Mountain Arsenal,	Hazardous Waste
Disposal Facilities Closure project. If the employee is not capable of reproduction.	a female, she is
date signed:	
Date:	•
	√
	•
Signed	M.O. \$88EDEDET
Cleane	
Closure of Hazardous Waste Disposal Facility at Basin F	
The contract of the contract o	• • •
Rocky Mountain Arsenal Commerce City, Colorado	;
medical Cartificata	
I certify that I have reexamined Earl Rios	00 454.
months of employment on the Rocky	on this
Mazardous Waste Disposal Facilities Closure project, and c	mountain Arsenai,
s free of symptomatology and c	ertify that he/she
s free of symptomatology and signs of impairment of healts	related to such
ila K	
ate:	
	•
Signes Derl	_ M.O. (空后方会)
	3222307

I certify that I have examined	
cular reference to paragraph 4 of the project contract qualified to participate in the Rocky Mountain Arsenal, Disposal Facilities Closure project. If the employee is not capable of reproduction.	Maganda
date signed:	
Oate:	·
	•
Signed	M.O. (BEIDIO)
Closure of Hazardous Waste Disposal Facility at Basin F Post-Employment Medical Evaluation Rocky Mountain Arsenal Commerce City, Colorado Medical Gertificate	
I certify that I have reexamined lobert to	Q on this
Hazardous Waste Disposal Facilities Classes	•
control of the second s	
is free of symptomatology and signs of impairment of healt employment.	h related to such
Date: 11/20/27	
Signes Signes	_ M.O. (発表多)

I certify that I have examine		
cular reference to paragraph qualified to participate in to Disposal Facilities Closure ponot capable of reproduction.	ne Kocky Mountain and	
date signed:		
Oate:		•
		· 4
Signed _		M.O. \$8820202)
Post-Emplo Rock Commer Med	e of Hazardous Waste Il Facility at Basin F yment Medical Evaluation y Mountain Arsenal rce City, Colorado ical Cartificate	
I certify that I have reexamined date following months o Hazardous Waste Disposal Facilit	/	
is free of symptomatology and signment.	ins of impairment of hea	ith related to such
Date: 11/20/5	1	
Signed Signed	Rells	
		M.O. 经完全多少

I certify that I have examined	with parti
cular reference to paragraph 4 of the project contract and qualified to participate in the Rocky Mountain Arsenal, in Disposal Facilities Closure project. If the employee is not capable of reproduction.	d declare him/her
date signed:	
Oate:	• • • • • • • • • • • • • • • • • • •
Signed	M.Q. \$5819191)
Closure of Hazardous Waste Disposal Facility at Basin F Post-Employment Medical Evaluation Rocky Mountain Arsenal Commerce City, Colorado Medical Certificate	
I certify that I have reexamined	on this
date following months of employment on the Rocky A dazardous Waste Disposal Facilities Closure project, and ca	buntain Arsenal,
s free or symptomatology and signs of impairment of health	related to such
ate: $\frac{1/zo/s}{}$	LAIGES ES SUCH
Signés //////	M.D. (95:55)

I certify that I	have examined	Ed	Kub .	•
cular reference qualified to par	to paragraph 4 of ticipate in the R ies Closure projec	the proje	ain Arsenal, H	with parti d declare him/her azardous Waste a female, she is
date signed: ///	9/15	.•	,	, ; ; ; ; ; ; ; ; ; ; ; ; ; ; ; ; ; ; ;
	Signed	Ber	der .	M.O. \$58101017
	Post-Employmer Rocky Mo Commerce	f Hazardous acility at nt Medical Duntain Ars City, Cold Certifica	Basin F Evaluation Senal	
I certify that I h				
Hazardous Waste Dissis free of symptoms Imployment.	months of e	Closure p	roject, and ce	on this ountain Arsenal, rtify that he/she related to such
	\$1gned			, M.O. <u>(25</u> 55)

I certify that I have examined Nobe	with parti
cular reference to paragraph 4 of the project contract an	d declare him/hom
qualified to participate in the Rocky Mountain Arsenal, H	AZAPGOUS Masta
Disposal Facilities Closure project. If the employee is	a famale, she is
not capable of reproduction.	•
date signed:	
Data:	· · · · · · · · · · · · · · · · · · ·
	. ◀
Signed	M.O. \$8610101)
Closure of Hazardous Waste Disposal Facility at Basin F Post-Employment Medical Evaluation Rocky Mountain Arsenal Commerce City, Colorado Medical Certificate	
I certify that I have reexamined Dobert Sport	_
date following months of employment on the Rocky A	on this
Hazardous Waste Disposal Facilities Closure project, and ce	buntain Arsenal,
is free of symptomatology and signs of impairment of health	irtify that he/she
employment.	related to such
Date: 11/20/55	
Signes / Deul	M.O. (到于多年)

M.O. (95555)

Closure of Hazardous Waste.
Disposal Facility at Basin F
Rocky Mountain Arsenal
Commerce City, Colorado

Certificate of Medical Examination
Cular reference to narrows A services Tenning with parti
cular reference to paragraph 4 of the project contract and declare him/her
qualified to participate in the Rocky Mountain Arsenal, Hazardous Waste
Oisposal Facilities Closure project 15 at
Oisposal Facilities Closure project. If the employee is a female, she is not capable of reproduction.
date signed:
Date: 10/11/15
Signed
Closure of Hazardous Waste Disposal Facility at Basin F Post-Employment Medical Evaluation Rocky Mountain Arsenal Commerce City, Colorado Medical Cartificate
I certify that I have reexamined
date following months of employment on the Rocky Mountain Arsenal, Hazardous Waste Disposal Facilities Closure project, and certify that he/she is free of symptomatology and
is free of symptomatology and signs of impairment of health related to such employment.
Date:

Signes

I certify that I	have examined	
cular reference to qualified to part Oisposal Faciliti	to paragraph 4 of the project contract a dicipate in the Rocky Mountain Arsenal, i es Closure project. If the employee is	Иза вана (
not capable of re	production.	
date signed:		
Oate:		• • • • • • • • • • • • • • • • • • •
	Signed	M.O. \$8#10101)
	Closure of Hazardous Waste Disposal Facility at Basin F Post-Employment Medical Evaluation Rocky Mountain Arsenal Commerce City, Colorado Medical Certificate	
certify that I ha	ve reexamined laws to t	on this
2000 013	months of employment on the Rocky Posal Facilities Closure project, and co	
s free of symptomet uployment.	cology and signs of impairment of health	related to such
11/20/85	Signes Meub	M.O. James
		M.O. ś究后多多)

our tiricate of Medical Examination	
I cortify that I have examined	with a
cular reference to paragraph 4 of the project contract o	
Cualified to serticipate in the Books Marks	me accide played
qualified to participate in the Rocky Mountain Arsenal,	lesardous liste
Disposal Factifities Closure project. If the employee is	& female, she to
net causie of reproduction.	
date signed:	
Pate:	
Signed	
- 1967年 - 19	
Closure of Hazardous Waste	
Disposal Facility at Basin F Post-Employment Medical Evaluation	
MUCKY ADUNTAIN APRAGAI	
Commerce City, Colorado Medical Certificate	
cortify that I have reexamined the Chersh	as this
months of employment on the Rocky I	louge sta to a
Free of supersons	antella ta tantil.
free of syntames law and co	rtily that he/shi
free of symptometology and signs of impairment of health	related to such
logment.	
" n'ileal -	•
· // 19/5 (
$\mathcal{A}\mathcal{h}$	
Signes	
(%) (%) (%) (%) (%) (%) (%) (%) (%) (%)	, 4.0. sambaj

I certify that I have examined	
cular reference to paragraph 4 of the project contract and qualified to participate in the Rocky Mountain Arsenal, Ha Disposal Facilities Closure project. If the employee is a not capable of reproduction.	1748daue Usas
date signed:	
Date:	
	≪ i
Signed	_ M.D. {@E10101
Closure of Hazardous Waste Disposal Facility at Basin F Post-Employment Medical Evaluation Rocky Mountain Arsenal Commerce City, Colorado Medical Certificate	
I certify that I have reexamined Ground date following months of employment on the Rocky Mo	on this
Hazardous Waste Disposal Facility	untain Arsenal,
Hazardous Waste Disposal Facilities Closure project, and cer	tify that he/she
is free of symptomatology and signs of impairment of health employment.	related to such
Date: 10/18	
Signed Moent	M.D. <u>(pr: 45</u> 5)

EXIT PHYSICAC

Closure of Hazardous Waste.
Disposal Facility at Basin F
Rocky Mountain Arsenal
Commerce City, Colorado

		Dound 7	with parti
cular reference	to paragraph	4 of the project con	tract and declare him/her
qualified to pa	irticipate in ti	ne Rocky Mountain Ar	senal, Hazardous Wasta
Oisposal Facili	ties Closure pr	oject. If the emplo	Type is a female, she is
not capable of	reproduction.		
date signed:			
Date: 10-29	5-85		
		,	. •
	Signed	B Colle	M.Q. <u>{āĒĒDIGI</u> }
	Closur Oisposa	re of Hazardous Wast al Facility at Basin	
	rust +emp (c	lyment Medical Evalu.	r ation
	Comme	y Mountain Arsenal erce City, Colorado	;
I contiduate t	Med	lical Certificate	
I certify that I			on this
date following _	months	of employment on the	Rocky Mountain Arsenal,
Hazardous Waste (Disposal Facili	ties Closure project	, and certify that he/she
is free of sympto	matology and s	igns of impairment o	f health related to such
employment.			. Hearth Ferated to such
Date:			
	-		
	Signed		
	a. Auen		M.D. (空音多多)

	m. 11.00 1 (M)
I cortify that I have examined	with a see t
cular reference to paragraph 4 of the project of	Contract and declare has
qualified to participate in the Rocky Mountain	A SELECTION
Disposal Escilities Closure and August Fountain	Arsonal, Mazerdous Maste
Disposal Facilities Closure project. If the en	ployee is a female, she is
net camable of reproduction.	
date signed:	
Oate:	
	•
Signed	
6100000	
Closure of Hazardous Wa Disposal Facility at Bas	
" Publication of Medical Eva	luation
Rocky Mountain Arsena Commerce City, Colored	
Medical Certificate	MARK ZIKE
cortify that I have reexamined	
	on tals
ment ou min o' min o'ment ou	the Rocky Mountain Arsenal.
lazardous Waste Disposal Facilities Closure proje	ict, and cartify that before
s free of symptometology and signs of impairment	
B010 went.	or neerth relates to such
rlich	
te: 1/1/7/#(
Signes	M.O. 10544

	I have examined	deb
	to paragraph 4 of the project contract a rticipate in the Rocky Mountain Arsenal,	• •
not capable of	ties clusure project. If the employee to	& female, she is
date signed:		•
Oate:		• .
		• • • • • • • • • • • • • • • • • • •
	Signed	M.O. (MEDIDI)
	Closure of Hazardous Waste Disposal Facility at Basin F Post-Employment Medical Evaluation Rocky Mountain Arsenal Commerce City, Colorado Medical Certificate	
I certify that [h	lave reexamined Dan Button	on this
Hazardous Waste Di	months of employment on the Rocky N	buntain Arsenal,
is free of symptom	sposal Facilities Closure project, and ca	rtify that he/she
employment.	atology and signs of impairment of health	related to such
Date: 1/15	St. B. Calhoun	ω
	Signed	M.O. 经完多会)
	1 7.	

Certificate of Medical Examination	
I certify that I have examined Alium woder	with parti
cular reference to paragraph 4 of the project contract and	declare hig/her
qualified to participate in the Rocky Mountain Arsenal, Haz	APROME Hares
Disposal Facilities Closure project. If the employee is a	famala eba ta
not capable of reproduction.	. and 141 918 12
date signed: 10-28-55	•
Oate: 15-38.85	4
Signed	M.Q. \$8EE0505)
	tat=0:0:)
Closure of Hazardous Waste Disposal Facility at Basin F Post-Employment Medical Evaluation Rocky Mountain Arsenal Commerce City, Colorado Medical Cartificate	
I certify that I have reexamined ALVIN wood	\sim on this
date following // months of employment on the Rocky Mou	intain Assess
Mazardous Waste Disposal Facilities Closure project, and cert	den apra polici
imployment.	elated to such
ate: Signed	Jorn
Ser '	
Signed	1.0. 经主办会)

	Certificati	e of Medical Exam	ination	
I certify that I	have examined	Philip	Del	_
cular reference t	- O paragraph 4 c	of the engine	varu	with parti-
qualified to part	icinate in the	or the project col	ntract and	declare him/her
Qualified to part	.c.bare in the	Rocky Mountain A	rsenal, Haz	ardous Waste
	es Closure proj	ect. If the empl	oyee is a	female, she is
not capable of re	production.	•		
Date:	8			
•	Signed	M	٠	M.O. /on O.O.
	61			M.D. (or D.O.)
		of Hazardous Wast acility at Basin		
	Rocky M	lountain Areana	ation	
	AOUNTELCE	City, Colorado I Certificate		
I certify that I have	Ve reexamined	. Gertiritate		
4.4				on this
	months of	employment on the	Rocky Mou	ntain Arsenal,
		Closure project		
is free of symptomat employment.	ology and signs	of impairment of	f health re	lated to such
Date:				
	Signed			
	-		M.	0. (or 0.0.)

I certify that	have examined	CAMINACION	
cular reference qualified to par	to paragraph 4 of the pr ticipate in the Rocky Mo les Closure project. If	roject contract and nuntain Arsenal, He the employee is a	with parti declare him/her Wardous Waste Fample, she is
date signed:			•
Date:			•
			ver i e
	Signed		_ M.O. \$86202027
	Closure of Hazard Disposal Facility Post-Employment Medic Rocky Mountain Commerce City, Co Medical Certifi	at Basin p al Evaluation Arsenal Diorago	
I certify that I have	re reexamined Patrice	it Warrie	•
Hazardous Waste Disp	months of employment	t on the Rocky Mou	ntain Arsenal,
is free of symptomat.	ology and sizes of least	project, and cert	Ify that he/she
employment.	ology and signs of impai	ment of health re	lated to such
Date: 14/18	•		
,	Signes		
	Ulli	М.	0. 经竞争多人

	CONTINUE TON
I certify that I have examined	with and
cular reference to paragraph 4 of the project qualified to participate in the Rocky Mountain	contract and declare him/her
Disposal Facilities Closure engine	marardous Waste
Disposal Facilities Closure project. If the en	iployee is a female, she is
date signed:	
Date:	
	· ,
	
Stgned	M.O. \$88101017
Closure of Hazardous We Disposal Facility at Bas Post-Employment Medical Eva Rocky Mountain Arsena Commerce City, Colorad Medical Certificate	in f Iluation
I certify that I have reexamined Chall V	asques on this
date following months of employee	on this
date following months of employment on	the Rocky Mountain Arsenal,
projection of the projection o	RCL. and came (du about both
is free of symptomatology and signs of impairment	of health calmad as
imployment.	
ete: 10-31-85 · Mh	
Signes	M A damage
	————— M.D. (空)

	os. tricate or Medical Exami	nation
I certify that I h	lave examined TRAV'S 4 m	moth with
cular reference to	paragraph 4 of the project con	with part
qualified to parti	Cinate in the factor Manager	tract and declare him/he
Disposal Facilitates	cipate in the Rocky Mountain Ars	ienal, Hazardous Haste
0.00000 70011110	s Closure project. If the emplo	yee is a female, she is
cahanta ot Labi	roduction.	•
date signed:	[
Oate:		•
		v.,
	i, C	4 · 7
	Signed // Coll	M.O. tagener
		•
	Closure of Hazardous Haste Disposal Facility at Basin	•
		r Lion
·	Rocky Mountain Arsenal Commerce City, Colorado	:
•	medical Certificate	
I certify that I have	e reexemined draws 100	imath!
date following	months of employment on the	an this
lazardous Waste Dispo	SAI FACILIFIE Classes	Mocky Mountain Arsenal,
s free of symptomes	osal Facilities Closure project,	and certify that he/she
	ology and signs of impairment of	health related to such
mployment.	•	
ile: 11-1-85		• • •
	$\overline{}$	
	11//	
	Signes	M.O. ś究:多多)
	 	·

Certificate of Medical Examination

Cular reference to paragraph 4 of the project contract and declare him/her qualified to participate in the Rocky Mountain Arsenal, Hazardous Haste Disposal Facilities Closure project. If the employee is a female, she is not capable of reproduction.

date signed: 11-1-85

Signed 15611 M.O. 688:0:0:0:

Closure of Hazardous Waste
Disposal Facility at Basin F
Post-Employment Medical Evaluation
Rocky Mountain Arsenal
Commerce City, Colorado
Medical Certificate

date following months of employment on the Rocky Mountain Arsenal.

Hazardous Waste Disposal Facilities Closure project, and certify that he/she is free of symptomatology and signs of impairment of health related to such employment.

Date:

Signes

M.O. (protect)

Dogo.

Certificate of Medical Examination

I certify that I have examined Rick Jonos — with particular reference to paragraph 4 of the project contract and declare him/her qualified to participate in the Rocky Mountain Arsenal, Hazardous Waste Disposal Facilities Closure project. If the employee is a female, she is not capable of reproduction.

Closure of Hazardous Waste
Disposal Facility at Basin F
Post-Employment Medical Evaluation
Rocky Mountain Arsenal
Commerce City, Colorado
Medical Certificate

I certify that I have reexamined Ruck Jones on this date following of months of employment on the Rocky Mountain Arsenal, Hazardous Waste Disposal Facilities Closure project, and certify that he/she is free of symptomatology and signs of impairment of health related to such employment.

Date: 10/20/85

Signed Come of mo

M.O. for-6:4:)

I certify that I have examined	
cular reference to paragraph 4 of the project contract qualified to participate in the Rocky Mountain Arsenal, Disposal Facilities Closure project. If the employee is not capable of reproduction.	
date signed:	•
Oate:	
Signed	M.Q. (8610101)
Closure of Hazardous Waste Disposal Facility at Basin F Post-Employment Medical Evaluation Rocky Mountain Arsenal Commerce City, Colorado Medical Certificate	
date following months of employment on the 2011	
Mazardous Waste Disposal Facilities Closure project, and calls free of symptomatology and signs of impairment of health employment.	
Date: 11/14/85	
Signes : Desci	M.O. ś熙秀多)

Certificate of Medical Examination	
I certify that I have examined McKi Month cular reference to paragraph 4 of the project contract an qualified to participate in the Rocky Mountain Arsenal, h Disposal Facilities Closure project. If the employee is not capable of reproduction.	d declare him/her
date signed: 10-28-85 Data: 10-28-85	
Closure of Hazardous Waste Disposal Facility at Basin F Post-Employment Medical Evaluation Rocky Mountain Arsenal Commerce City, Colorado Medical Certificate	
[certify that [have reexamined	on this
Hazardous Waste Disposal Facilities Closure project, and coils free of symptomatology and signs of impairment of health employment.	Countain Arsenal,
Date:	

Signed	•	* 0	da
-		n.u.	经税额

Certificate of Medical Examination

I certify that I have examined Rus	302 22 P
octor termine to paragraph 4 of the	project contract and dealine by
desired to participate in the Rocky	Mountain Arsenal Hannel
Disposal Facilities Closure project. not capable of reproduction.	If the employee is a female, she is
date signed: 10 -28-85	

date signed: 10-28-85

Closure of Hazardous Waste
Disposal Facility at Basin F
Post-Employment Medical Evaluation
Rocky Mountain Arsenal
Commerce City, Colorado
Medical Certificate

date following _____ months of employment on the Rocky Mountain Arsenal.

Hazardous Waste Disposal Facilities Closure project, and certify that he/she is free of symptomatology and signs of impairment of health related to such employment.

Date:

Stanes

M.O. (李三去去)

I certify that I have examined Dan Pauloem	with parti
cular reference to paragraph 4 of the project contract and	dealers by a
qualified to participate in the Rocky Mountain Arsenal, Ha	deciare him/her
Disposal Facilities Clause	Zardous Waste
Disposal Facilities Closure project. If the employee is a	female, she is
not capable of reproduction.	•
date signed: 10-25-75	•
Date: 10-25-85	
	≪
Signed	_ M.D. \$52101017
Disposal Facility at Basin F Post-Employment Medical Evaluation Rocky Mountain Arsenal Commerce City, Colorado Medical Certificate	
I certify that I have reexamined	on this
date following months of employment on the Rocky Mo	on cars
Mazardous Waste Disposal Facilities Classes	untain Arsenal,
lazardous Waste Disposal Facilities Closure project, and cer	tify that he/she
s free of symptomatology and signs of impairment of health	related to such
mployment.	
ate: 10/25/5 MM	
Signed	M B
	n.v. 335555)

Certificate of Medical Examination

I certify that I have examined <u>Fary Danislan</u> with particular reference to paragraph 4 of the project contract and declare him/her qualified to participate in the Rocky Mountain Arsenal, Hazardous Waste Disposal Facilities Closure project. If the employee is a female, she is not capable of reproduction.

date signed: 10-24-85

Date: 10-24-85

Signed			
•	M.Q.	######################################	j

Closure of Hazardous Waste
Disposal Facility at Basin F
Post-Employment Medical Evaluation
Rocky Mountain Arsenal
Commerce City, Colorado
Medical Cartificate

date following _____ months of employment on the Rocky Mountain Arsenal.

Hazardous Waste Disposal Facilities Closure project, and certify that he/she is free of symptomatology and signs of impairment of health related to such employment.

Date: 10/30/15

Signed

4.0. for-6:4:)

Certificate of Medical Examination [certify that I have examined __ cular reference to paragraph 4 of the project contract and declare him/her qualified to participate in the Rocky Mountain Arsenal, Hazardous Waste Disposal Facilities Closure project. If the employee is a female, she is not capable of reproduction. date signed: Signed Closure of Hazardous Waste Disposal Facility at Basin F Post-Employment Medical Evaluation Rocky Mountain Arsenal Commerce City, Colorado Medical Certificate I cartify that I have reexamined on this date following months of employment on the Rocky Mountain Arsenal. Mazardous Waste Disposal Facilities Closure project, and certify that he/she is free of symptomatology and signs of impairment of health related to such employment. Signed M.D. 经完多会)

Certificate of Medical Examination

I certify that I have examined Edium Otto I with particular reference to paragraph 4 of the project contract and declare him/her qualified to participate in the Rocky Mountain Arsenal, Hazardous Haste Disposal Facilities Closure project. If the employee is a female, she is not capable of reproduction.

date signed: 10-23-85-12/30/10-

Closure of Hazardous Waste
Disposal Facility at Basin F
Post-Employment Medical Evaluation
Rocky Mountain Arsenal
Commerce City, Colorado
Medical Cartificate

I certify that I have	ve reexamined Ed Atchoby	
date following	months of employment on the Rocky Mountain	on this
Hazardous Waste Disp	posal Facilities Closure project, and certify	in Arsenal,
is free of symptomat	cology and signs of impairment of health relat	that he/she
employment.		ed to such

Date: (3/3/8)

M.D. 红宝安安)

Certificate of Medical Examination

The state of the s	LKO Urbiokit with and
I certify that I have examined cular reference to paragraph 4 of the	project contract and declare him/hom
qualified to participate in the Rocky	Mountain Arsenal, Hazandous Hasa
Oisposal Facilities Closure project. not capable of reproduction.	If the employee is a female, she is

date signed: 10-24-85-Date: 10-24-85

Signed	M.Q.	\$0E=0:0;	ĭ
		770+0+	•

Closure of Hazardous Waste
Disposal Facility at Basin F
Post-Employment Medical Evaluation
Rocky Mountain Arsenal
Commerce City, Colorado
Medical Certificate

date following Just months of employment on the Rocky Mountain Arsenal, Hazardous Waste Disposal Facilities Closure project, and certify that he/she is free of symptomatology and signs of impairment of health related to such employment.

Date: 10/24/85

Signed

M.D. 经完务会)

Certificate of Medical Examination

I certify that I have examined cular reference to paragraph 4 of the project contract and declare him/her qualified to participate in the Rocky Mountain Arsenal, Hazardous Waste Disposal Facilities Closure project. If the employee is a female, she is not capable of reproduction.

date signed: 10-34-35 Date: 10-24-85

> Signed I.D. ¢ēēēbībījī

Closure of Hazardous Waste Disposal Facility at Basin F Post-Employment Medical Evaluation Rocky Mountain Arsenal Commerce City, Colorado,

Medical Cartificate

I certify that I have reexamined

date following _ months of employment on the Rocky Mountain Arsenal, Hazardous Waste Disposal Facilities Closure project, and certify that he/she is free of symptomatology and signs of impairment of health related to such

employment.

Signed

Certificate of Medical Examination

I certify that I have examined Anna Scrotter, with particular reference to paragraph 4 of the project contract and declare him/her qualified to participate in the Rocky Mountain Arsenal, Hazardous Waste Disposal Facilities Closure project. If the employee is a female, she is not capable of reproduction.

Date: 10-21-85	
	(am 130 /85
Signed	M.B. (or D.O.

Closure of Hazardous Waste
Disposal Facility at Basin F
Post-Employment Medical Evaluation
Rocky Mountain Arsenal
Commerce City, Colorado
Medical Certificate

I certify that I have reexamined	Soester,	Dum	on this
date following 1/2 months of	employment on	the Rocky Mountai	n Arsanal
Hazardous Waste Disposal Faciliti	es Closure ardi	ect and commiss.	the ballet
is free of symptomatology and sign	ns of impairmen	it of health relati	ed to such
employment.		•	

Certificate of Medical Examination	
I certify that I have examined Dian Roy !	with parts
cular reference to paragraph 4 of the project contract and	deelene it u
qualified to participate in the Rocky Mountain Arsenal, Haz	decidre nim/her
Disposal Facilities Closure project. If the employee is a	ardous Waste
not capable of reproduction.	female, she is
Date: 10 - 07 - 0 6:	
<u>10-59-82</u>	
· //)	E
Signed $\sqrt{}$	M.D. (or 0.0.)
Closupe of Hannet	•
Closure of Hazardous Waste Disposal Facility at Basin F	÷
Rocky Mountain Arsenal	
Commerce City, Colorado Medical Certificate	
I certify that I have reexamined from Brail	
date following months of employment on the 3001 to	on this
Hazardous Waste Disposal Facilities Closure project, and certises free of august 1	ntain Arsenal,
is free of symptomatology and sizes of incident	ify that he/she
is free of symptomatology and signs of impairment of health remployment.	elated to such
Data: 19 /29 /	
1	
Date: 1 /3 / 50	

Signed

M.D. (or 0.0.)

ı,

with parts
d declare him/her
Mardous Haste
female, she is
•
At a constant
. ◀
M.O. £82102821
on this buntain Arsenal, rtify that he/she related to such
M.O. (空三安安)

Cular reference to paragraph 4 of the project contract qualified to participate in the Rocky Mountain Arsenal, Disposal Facilities Closure project. If the employee is not capable of reproducts	and declare him/he
not capable of reproduction. date signed: 10-30-85	
Signed	.
Closure of Hazardous Waste Disposal Facility at Basin F Post-Employment Medical Evaluation Rocky Mountain Arsenal Commerce City, Colorado Medical Certificate I certify that I have reexamined months of melowant	on this
months of employment on the Rocky lezardous Waste Disposal Facilities Closure project, and a stree of symptomatology and signs of impairment of healt mployment.	
Signes	M.O. (空三去去)

Certificate of Medical Examination

I certify that I have examined <u>Opmmo tlaninghouse</u> the particular reference to paragraph 4 of the project contract and declare him/her qualified to participate in the Rocky Mountain Arsenal, Hazardous Waste Disposal Facilities Closure project. If the employee is a female, she is not capable of reproduction.

date signed: 10-28-85

Date: 10-28-85

Closure of Hazardous Waste Disposal Facility at Basin F Post-Employment Medical Evaluation Rocky Mountain Arsenal Commerce City, Colorado Medical Certificate

date following _____ months of employment on the Rocky Mountain Arsenal,
Hazardous Waste Disposal Facilities Closure project, and certify that he/she
is free of symptomatology and signs of impairment of health related to such employment.

Date: __///9/85

Signes

M.D. 经完务会)

Certificate of Medical Examination

I certify that I have examined <u>Pichald in a property</u> with particular reference to paragraph 4 of the project contract and declare him/her qualified to participate in the Rocky Mountain Arsenal, Hazardous Waste Disposal Facilities Closure project. If the employee is a female, she is not capable of reproduction.

date signed: 10-28-85 Teles: 10-28-85

Signed M.O. \$88=DEDE

Closure of Hazardous Waste
Disposal Facility at Basin F
Post-Employment Medical Evaluation
Rocky Mountain Arsenal
Commerce City, Colorado
Medical Certificate

date following ______ months of employment on the Rocky Mountain Arsenal, Hazardous Waste Disposal Facilities Closure project, and certify that he/she is free of symptomatology and signs of impairment of health related to such employment.

Date: 10/75/KJ

Signed

M.D. (到55)

Certificate of Medical Examination

I certify that I have examined which the project contract and declare him/her cular reference to paragraph 4 of the project contract and declare him/her qualified to participate in the Rocky Mountain Arsenal, Hazardous Waste Disposal Facilities Closure project. If the employee is a female, she is not capable of reproduction.

Closure of Hazardous Waste

Oisposal Facility at Basin F

Post-Employment Medical Evaluation

Rocky Mountain Arsenal

Commerce City, Colorado

Medical Certificate

I certify that I have reexamined Michigal Michigal on this date following _____ months of employment on the Rocky Mountain Arsenal. Hazardous Waste Disposal Facilities Closure project, and certify that he/she is free of symptomatology and signs of impairment of health related to such employment.

Date: 10/25/55

Signed

M.O. (95-55)

I certify that I have examined John Roll	with parti
cular reference to paragraph 4 of the project contract a	nd declare him/her
qualified to participate in the Rocky Mountain Arsenal, I	lazardous Wassa
Disposal Facilities Closure project. If the employee is	à female, she te
not capable of reproduction.	
date signed: 10-28-8- (3/3-/8)	
Date: 10-28-85	·
Comer St m	,≰
Signed	
	M.Q. \$82191917
Closure of Hazardous Waste Disposal Facility at Basin F	
Post-Employment Medical Evaluation Rocky Mountain Arsenal	
Commerce City, Colorado Medical Cartificata	:
I certify that I have reexamined John Bell	as this
date following months of employment on the Rocky ? Mazardous Waste Disposal Facilities Closure	on this
Mazardous Waste Disposal Facilities Closure project, and co	Duitein Arsenai,
is free of symptomatology and signs of impairment of health	ertify that he/she
employment.	related to such
Dite à en 1921/5	
ate: _17/30/85	
Signes Conver Shap	
Signed	M.D. (95-55)

Certificate of Medical Examination

estimation and the standard standards and the standards are standards and the standards are standards and the standards are stan	•
I certify that I have examined Rilly Jenning	•
cular reference to paragraph 4 of the arrive	with parti
cular reference to paragraph 4 of the project contract as	nd declare him/her
qualified to participate in the Rocky Mountain Arsenal, h	lazardous Wasta
the employee te	4 female, the te
not capable of reproduction.	
date signed: 10-28-85-	
Date: 10-28-85	
	, , , , , , , , , , , , , , , , , , ,
	• •
Signed	M.Q. \$82191817
Closure of Hazardous Waste Disposal Facility at Basin F	
	• • •
Commerce City, Colorado	:
redical Lartificata	
I certify that I have reexamined Bull Commen	1
months of employment on the and	on this
Hazardous Waste Disposal Facilities Closure project, and cer	puntain Arsenal,
is free of symptomatology and sizes of	tify that he/she
is free of symptomatology and signs of impairment of health employment.	related to such
Date: 10/28/87	
Date:	
Signed	
Signed Signed	

I certify that I have examined	•••
cular reference to paragraph 4 of the project contract qualified to participate in the Rocky Mountain Arsenal Disposal Facilities Closure project. If the employee not capable of reproduction.	••
date signed:	
Date:	. .
	• • • • • • • • • • • • • • • • • • •
Signed	M.O. ###IDEDET)
Closure of Hazardous Waste Disposal Facility at Basin F Post-Employment Medical Evaluation Rocky Mountain Arsenal Commerce City, Colorado Medical Certificate	
date following months of employment on the Real	melicileon this
The state of the s	•
is free of symptomatology and signs of impairment of healt employment.	th related to such
Oate: 11/15/16	*. ⁴
Signed MSut	_ M.O. (95:555)